



Asbestos Assessment

St. Mary Catholic ERC
209 MacNab Street, Hamilton, ON,
L8R1B5

Prepared for:

Hamilton-Wentworth Catholic District School Board

90 Mulberry Street
Hamilton, Ontario, L8N 3R9

August 31, 2023

Pinchin File: 320582.004



Asbestos Assessment

St. Mary Catholic ERC, 209 MacNab Street, Hamilton, ON, L8R1B5
Hamilton-Wentworth Catholic District School Board

August 31, 2023
Pinchin File: 320582.004

Issued to: Hamilton-Wentworth Catholic District School Board
Issued on: August 31, 2023
Pinchin File: 320582.004
Issuing Office: Hamilton, ON
Primary Contact: Emily Balfour, Project Manager, ebalfour@pinchin.com

Author:

Emily Balfour
Project Manager
365.889.5147
ebalfour@pinchin.com

Reviewer:

Damian Palus, C.E.T.
Operations Manager
289.678.0694
dpalus@pinchin.com



EXECUTIVE SUMMARY

Hamilton-Wentworth Catholic District School Board (Client) retained Pinchin Ltd. (Pinchin) to conduct an asbestos building materials assessment of St. Mary Catholic ERC located at 209 MacNab Street, Hamilton, ON, L8R1B5.

The objectives of the assessment were to document the locations of asbestos building materials, evaluate their condition and develop corrective action plans as required for the purposes of long-term management. The results of this assessment are not intended for construction, renovation, demolition or project tendering purposes.

SUMMARY OF RECOMMENDATIONS

The following is a summary of significant recommendations; refer to the body of the report for detailed recommendations:

1. Maintain the Asbestos Management Program (AMP)
2. Perform a re-assessment of asbestos materials on an annual basis.
3. Perform a pre-construction assessment and remove all ACM prior to alteration or maintenance work if ACM may be disturbed by the work.
4. Follow appropriate safe work procedures when handling or disturbing asbestos.
5. Sample any presumed ACM prior to alteration or maintenance work if presumed ACM may be disturbed by the work.
6. Update the asbestos inventory report upon completion of any abatement and removal of asbestos-containing materials.

This Executive Summary is subject to the same standard limitations as contained in the report and must be read in conjunction with the entire report.



TABLE OF CONTENTS

1.0 INTRODUCTION AND SCOPE 1
 1.1 Scope of Assessment 1
2.0 METHODOLOGY 1
3.0 BACKGROUND INFORMATION 1
 3.1 Building Year of Construction and Additions 1
 3.2 Existing Reports 1
 3.3 Inaccessible Locations 2
4.0 FINDINGS 2
 4.1 Excluded Asbestos Materials 2
 4.2 Summary of Building Materials 3
5.0 RECOMMENDATIONS 6
 5.1 General 6
 5.2 Remedial Work 6
 5.3 On-going Management and Maintenance 6
6.0 TERMS AND LIMITATIONS 6
7.0 REFERENCES 7

APPENDICES

APPENDIX I Drawings
APPENDIX II Asbestos Analytical Certificates
APPENDIX III Methodology
APPENDIX IV Location List
APPENDIX V Summary Report / Sample Log
APPENDIX VI HMIS All Data Report



1.0 INTRODUCTION AND SCOPE

Hamilton-Wentworth Catholic District School Board (Client) retained Pinchin Ltd. (Pinchin) to conduct an asbestos building materials assessment of St. Mary Catholic ERC located at 209 MacNab Street, Hamilton, ON, L8R1B5.

Pinchin performed the assessment on July 20, 2023.

The objectives of the assessment were to document the locations of asbestos building materials, evaluate their condition and develop corrective action plans as required. This assessment is only to be used for the purposes of long-term management and routine maintenance. The results of this assessment are not to be used for construction, renovation, demolition, or project tendering purposes.

1.1 Scope of Assessment

The assessment was performed to establish the location and type of asbestos building materials incorporated in the structure(s) and its finishes. The **assessed area** consisted of all parts of the building, excluding the roof.

2.0 METHODOLOGY

Pinchin conducted a room-by-room assessment (rooms, corridors, service areas, exterior, etc.) to identify the asbestos-containing building materials as defined in the scope.

The assessment was limited to non-intrusive testing. Concealed spaces such as those above solid ceilings and within shafts and pipe chases were accessed via existing access panels only. Demolition of walls, solid ceilings, structural items, interior finishes or exterior building finishes, to determine the presence of concealed materials was not conducted.

For further details on the methodology including test methods, refer to Appendix III.

3.0 BACKGROUND INFORMATION

3.1 Building Year of Construction and Additions

Item	Details
Year of Construction	1959

3.2 Existing Reports

Pinchin previously prepared the following report, which has been reviewed as part of this assessment:

- Asbestos Reassessment Report, St. Mary Catholic ERC, August 2022, Pinchin File No. 303992.004.



3.3 Inaccessible Locations

Inaccessible locations (rooms or areas), if any, are indicated in the Location List Report in Appendix IV. These locations within the assessed area were not accessible to the surveyor and are therefore not included in the report.

4.0 FINDINGS

The following section summarizes the findings of the assessment and provides a general description of the asbestos-containing materials (ACM) identified and their locations. For details on approximate quantities, condition, friability, accessibility and locations of asbestos materials; refer to the Asbestos Material Summary Report and All Data Report in Appendix V and VI.

4.1 Excluded Asbestos Materials

A number of materials which might contain asbestos were not sampled during this assessment due to limitations in scope and methodology. Where present, these materials are assumed to contain asbestos until otherwise proven by sampling and analysis. These materials are not shown on the drawings in Appendix I. Excluded materials presumed to contain asbestos include:

- Roofing felts and tar, mastics
- Floor levelling compound
- Ceramic tile setting compound
- Elevator and lift brakes
- Electrical components
- Mechanical packing, ropes and gaskets
- Vermiculite
- Adhesives and duct mastics
- Caulking and putties
- Fibre-reinforced paints and coatings
- Paper products
- Soffit and fascia boards
- Fire resistant doors
- Stucco, plaster or other cementitious parge coatings
- Vibration dampers on HVAC equipment
- Terrazzo


- Ropes and gaskets in cast-iron bell and spigot joints
- Sealants on pipe threads



4.2 Summary of Building Materials



This section includes a summary of building materials that have been confirmed asbestos-containing by sample analysis, presumed asbestos-containing by visual identification, or confirmed non-asbestos by sampling or based on the manufacture date and known end of use of asbestos in these products.

The locations of samples from historical assessments performed by Pinchin, have been included on the drawings.

Appendix II presents the asbestos bulk sample analytical results.

Material and Application	Asbestos Type	Photo
Parging cement is present on pipe fittings (elbows, valves, tees, hangers etc.).	Chrysotile	
Remaining pipes are either uninsulated or insulated with non-asbestos fibreglass or elastomeric insulation (Armaflex).	None	
Ducts are either uninsulated or insulated with non-asbestos fibreglass (foil-faced or canvas).	None	
Mechanical equipment is either uninsulated or insulated with non-asbestos fibreglass.	None	

Material and Application	Asbestos Type	Photo
All ceiling tiles are non-asbestos from previous sampling, presumed to be non-asbestos based on the date of manufacture determined from the date stamp applied to the top of the tiles and the age of the materials determined from the age of the building.	None	
Drywall joint compound is present on wall and ceiling finishes.	None	
Asbestos in drywall joint compound was banned in Canada in 1980. The building was constructed after 1986 (1980 plus a reasonable non-compliance period based on our experience) and the drywall joint compound is assumed to contain no asbestos.	None	
Transite board is present underneath stairs.	Presumed	
Vinyl floor tiles, 9"x9" and 12"x12", various colours, are present.	Chrysotile/Presumed (tile) Presumed (mastic)	

Material and Application	Asbestos Type	Photo
<p>Remaining vinyl floor tiles are presumed to be non-asbestos based on historical knowledge of the date of installation.</p> <p>Mastic under non-asbestos tiles is presumed to contain asbestos until further sampling is performed.</p>	<p>None (tile) Presumed (mastic)</p>	
<p>Grey caulking is present around window frames.</p>	<p>Chrysotile</p>	
<p>Paper heat shields are present in light fixtures.</p>	<p>Presumed</p>	
<p>A fire door is present in the Boiler Room (Location 1016). Interior components are presumed to contain asbestos.</p>	<p>Presumed</p>	



5.0 RECOMMENDATIONS

5.1 General

Perform a detailed intrusive assessment prior to maintenance work, building renovation or demolition operations. The assessment should include destructive testing (e.g., coring and/or removal of building finishes and components), and other hazardous materials (lead, mercury, PCBs, mould, etc.) and materials not tested in this study (e.g., roofing materials, caulking, mastics).

5.2 Remedial Work

No remedial work is recommended.

5.3 On-going Management and Maintenance

The following recommendations are made regarding on-going management and maintenance work involving the asbestos materials identified.

Maintain the Asbestos Management Program (AMP).

Perform a reassessment of asbestos materials on an annual basis.

Remove asbestos-containing materials (ACM) prior to alteration or maintenance work if ACM may be disturbed by the work. Follow appropriate asbestos precautions for the classification of work being performed.

Sample presumed ACM prior to alteration or maintenance work if the presumed ACM may be disturbed by the work.

Update the asbestos inventory report upon completion of any abatement and removal of asbestos-containing materials.

6.0 TERMS AND LIMITATIONS

This work was performed subject to the Terms and Limitations presented or referenced in the proposal for this project.

Information provided by Pinchin is intended for Client use only. Pinchin will not provide results or information to any party unless disclosure by Pinchin is required by law. Any use by a third party of reports or documents authored by Pinchin or any reliance by a third party on or decisions made by a third party based on the findings described in said documents, is the sole responsibility of such third parties. Pinchin accepts no responsibility for damages suffered by any third party as a result of decisions made or actions conducted. No other warranties are implied or expressed.



7.0 REFERENCES

The following legislation and documents were referenced in completing the assessment and this report:

1. Asbestos on Construction Projects and in Buildings and Repair Operations, Ontario Regulation 278/05.
2. Designated Substances, Ontario Regulation 490/09.
3. Ministry of the Environment Regulation, R.R.O. 1990 Reg. 347 as amended.

\\PIN-HAM-FS02\job\320000s\0320582.000 HWCDsB,Various2023Projects,ASB,CONS\0320582.004 HWCDsB,AllSites,2023,ASB,ASSMT\Deliverables\St. Mary Catholic ERC\Deliverables\320582.004 Asbestos Asmnt Report St. Mary Catholic ERC HWCDsB Aug 31 2023.docx

Template: Master Report for Asbestos Assessment, HAZ, July 29, 2021

APPENDIX I
Drawings

NOT ALL KNOWN OR SUSPECTED ASBESTOS BUILDING MATERIALS MAY BE DEPICTED ON THE DRAWING. REFER TO THE ASBESTOS REASSESSMENT REPORT FOR A COMPLETE LIST OF KNOWN AND SUSPECTED ASBESTOS BUILDING MATERIALS.

LEGEND IS COLOUR DEPENDENT. NON-COLOUR COPIES MAY ALTER INTERPRETATION.

BASE PLAN PROVIDED BY CLIENT.



905-577-6206

www.pinchin.com

LEGEND:

- (X) LOCATION NUMBER
- ⊙ ASBESTOS BULK SAMPLE

ASBESTOS-CONTAINING MATERIALS:

- [P] PIPE INSULATION
- [Grid] TRANSITE PANELING
- [Light Blue] VINYL FLOOR TILES AND MASTIC
- [Yellow] MASTIC
- [Cross-hatch] PAPER HEAT SHIELD
- [FD] FIRE DOOR
- [C] WINDOW CAULKING



CLIENT:



LOCATION:

ST. MARY RESOURCE
209 MACNAB STREET NORTH
HAMILTON, ONTARIO

TITLE:

ASBESTOS ASSESSMENT
FLOOR LEVEL 1

DATE:

AUGUST 2023

PROJECT #:

320582.004

DRAWN BY:

EB

DRAWING:

CHECKED BY:

EB

1 OF 3

SCALE:

NTS

NOT ALL KNOWN OR SUSPECTED ASBESTOS BUILDING MATERIALS MAY BE DEPICTED ON THE DRAWING. REFER TO THE ASBESTOS REASSESSMENT REPORT FOR A COMPLETE LIST OF KNOWN AND SUSPECTED ASBESTOS BUILDING MATERIALS.

LEGEND IS COLOUR DEPENDENT. NON-COLOUR COPIES MAY ALTER INTERPRETATION.

BASE PLAN PROVIDED BY CLIENT.



905-577-6206

www.pinchin.com

LEGEND:

- (X) LOCATION NUMBER
- ⊙ ASBESTOS BULK SAMPLE

ASBESTOS-CONTAINING MATERIALS:

- P PIPE INSULATION
- TRANSITE PANELING
- VINYL FLOOR TILES AND MASTIC
- MASTIC
- PAPER HEAT SHIELD
- FD FIRE DOOR
- C WINDOW CAULKING



CLIENT:



LOCATION:

ST. MARY RESOURCE
209 MACNAB STREET NORTH
HAMILTON, ONTARIO

TITLE:

ASBESTOS ASSESSMENT
FLOOR LEVEL 2

DATE:

AUGUST 2023

PROJECT #:

320582.004

DRAWN BY:

EB

DRAWING:

2 OF 3

CHECKED BY:

EB

SCALE:

NTS

NOT ALL KNOWN OR SUSPECTED ASBESTOS BUILDING MATERIALS MAY BE DEPICTED ON THE DRAWING. REFER TO THE ASBESTOS REASSESSMENT REPORT FOR A COMPLETE LIST OF KNOWN AND SUSPECTED ASBESTOS BUILDING MATERIALS.

LEGEND IS COLOUR DEPENDENT. NON-COLOUR COPIES MAY ALTER INTERPRETATION.

BASE PLAN PROVIDED BY CLIENT.



905-577-6206

www.pinchin.com

LEGEND:

- LOCATION NUMBER
- ASBESTOS BULK SAMPLE

ASBESTOS-CONTAINING MATERIALS:

- PIPE INSULATION
- TRANSITE PANELING
- VINYL FLOOR TILES AND MASTIC
- MASTIC
- PAPER HEAT SHIELD
- FIRE DOOR
- WINDOW CAULKING



CLIENT:



LOCATION:

ST. MARY RESOURCE
209 MACNAB STREET NORTH
HAMILTON, ONTARIO

TITLE:

ASBESTOS ASSESSMENT
FLOOR LEVEL 3

DATE:

AUGUST 2023

PROJECT # :

320582.004

DRAWN BY:

EB

DRAWING:

3 OF 3

CHECKED BY:

EB

SCALE:

NTS

APPENDIX II
Asbestos Analytical Certificates



Pinchin Ltd. Asbestos Laboratory Certificate of Analysis

Project Name: Hamilton-Wentworth Catholic School Board,
St. Mary Catholic Education Resource Centre,
209 MacNab Street North, Hamilton, Ontario

Project No.: 0272113.000

Prepared For: E. Balfour / M. Maiorana

Lab Reference No.: b230639

Analyst(s): K. Cockburn

Date Received: May 21, 2020

Date Analyzed: May 28, 2020

Samples submitted: 3

Phases analyzed: 1

Method of Analysis:

EPA 600/R-93/116 - Method for the Determination of Asbestos in Bulk Building Materials dated July, 1993

Bulk samples are checked visually and scanned under a stereomicroscope. Slides are prepared and observed under a Polarized Light Microscope (PLM) at magnifications of 40X, 100X or 400X as appropriate. Asbestos fibres are identified by a combination of morphology, colour, refractive index, extinction, sign of elongation, birefringence and dispersion staining colours. A visual estimate is made of the percentage of asbestos present. A reported concentration of less than (<) the regulatory threshold (see chart below) indicates the presence of confirmed asbestos in trace quantities, limited to only a few fibres or fibre bundles in an entire sample. This method complies with provincial regulatory requirements where applicable. Multiple phases within a sample are analyzed and reported separately.

All bulk samples submitted to this laboratory for asbestos analysis are retained for a minimum of three months. Samples may be retrieved, upon request, for re-examination at any time during that period.

The Pinchin Ltd. Mississauga asbestos laboratory is accredited by the National Institute of Standards and Technology, National Voluntary Laboratory Accreditation Program (NVLAP Lab Code 101270-0) for the 'EPA – 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples,' and the 'EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials'; and meets all requirements of ISO/IEC 17025:2005.

This report relates only to the items tested.

NOTE: *This test report may not be reproduced, except in full, without the written approval of the laboratory. The client may not use this report to claim product endorsement by NVLAP or any agency of the U.S. Government. This report is valid only when signed in blue ink by the analyst. Vinyl asbestos floor tiles contain very fine fibres of asbestos and may be missed by some laboratories using the PLM method. Internal verification studies performed by Pinchin indicate that the chance of missing asbestos in floor tiles is no higher than about 2%. The vinyl tile study and laboratory documentation on measurement uncertainty is available upon request. The analysis of dust samples by PLM cannot be used as an indicator of past or present airborne asbestos fibre levels.*



Pinchin Ltd. Asbestos Laboratory
Certificate of Analysis

Project Name: Hamilton-Wentworth Catholic School Board,
St. Mary Catholic Education Resource Centre,
209 MacNab Street North, Hamilton, Ontario

Project No.: 0272113.000

Prepared For: E. Balfour / M. Maiorana

Lab Reference No.: b230639

Date Analyzed: May 28, 2020

BULK SAMPLE ANALYSIS

SAMPLE IDENTIFICATION	SAMPLE DESCRIPTION	% COMPOSITION (VISUAL ESTIMATE)	
		ASBESTOS	OTHER
S0027A Parging cement, Corridor, Location 1013	Homogeneous, light grey, soft, parging cement.	Chrysotile > 75%	Non-Fibrous Material 10-25%
Comments:	Foil and hair are present on the surface of this sample.		
S0027B Parging cement, Corridor, Location 1013			Not Analyzed
Comments:	Analysis was stopped due to a previous positive result.		
S0027C Parging cement, Corridor, Location 1013			Not Analyzed
Comments:	Analysis was stopped due to a previous positive result.		

Reviewed by:

Reporting Analyst:



Analyzed by: *[Signature]*
 Reviewed by: *[Signature]*
 Report Sent by: *[Signature]*



Instructions:

**Pinchin Ltd. - Asbestos Laboratory
Internal Asbestos Bulk Sample Chain of Custody**

Client Name:	Hamilton-Wentworth Catholic School Board	Project Address:	209 MacNab Street North, Hamilton, Ontario
Portfolio/Building No:	St. Mary Catholic Education Resource Centre	Pinchin File:	272113
Submitted by:	Emily Balfour	Email:	ebalfour@pinchin.com
CC Results to:	Michael Maiorana	CC Email:	mmaiorana@pinchin.com
Invoice to:	Accounts Payable	Invoice Email:	ap@pinchin.com
Date Submitted:	May 19 2020	Required by:	May 26 2020
# of Samples:	3	Priority:	5 Day Turnaround
Year of Building Construction (Mandatory Field):	1959		
Do NOT Stop on Positive (Sample Numbers):			
Pinchin Group Company (Mandatory Field):	Pinchin		

To be Completed by Lab Personnel Only:

Lab Reference #:	<i>0230639</i>	Time:	24 hour clock
Received by:	<i>MAY 21 2020</i>	Date:	Month Day Year
Name(s) of Analyst(s):	<i>KC 2020/05/20</i>		

Sample Prefix	Sample No.	Sample Suffix	Sample Description/Location (Mandatory)
	S0027	A	Parging cement, Corridor, Location 1013 <i>CH > 75%</i>
	S0027	B	Parging cement, Corridor, Location 1013 <i>- NA -</i>
	S0027	C	Parging cement, Corridor, Location 1013 <i>- NA -</i>

APPENDIX III
Methodology

1.0 GENERAL

An inspection was conducted to identify the asbestos-containing materials (ACM) incorporated in the structure and its finishes as defined by the scope of work.

Information regarding the location and condition of ACM encountered and visually estimated quantities were recorded. The locations of any samples collected were recorded on small-scale plans. As-built drawings and previous reports were referenced where provided.

Sample collection (where performed) was conducted in accordance with our Standard Operating Procedures.

The inspection for asbestos included friable and non-friable asbestos-containing materials (ACM). A friable material is a material that when dry can be crumbled, pulverized or powdered by hand pressure.

Where samples were collected, a separate set of samples was collected of each type of homogenous material suspected to contain asbestos. A homogenous material is defined by the US EPA as material that is uniform in texture and appearance, was installed at one time, and is unlikely to consist of more than one type or formulation of material. The homogeneous materials were determined by visual examination and available information on the phases of construction and prior renovations.

Where samples were collected, samples were collected at a rate that is in compliance with the requirements of local regulations and guidelines. The sampling strategy was also based on known ban dates and phase out dates of the use of asbestos; sampling of certain building materials is not conducted after specific construction dates. In addition, to be conservative, several years past these dates are added to account for some uncertainty in the exact start / finish date of construction and associated usage of ACM. In some cases, manufactured products such as asbestos cement pipe were visually identified without sample confirmation.

Where samples were collected, the asbestos analysis was completed using a stop-positive approach. Only one result meeting the regulated criteria was required to determine that a material is asbestos-containing, but all samples must be analyzed to conclusively determine that a material is non-asbestos. The laboratory stopped analyzing samples from a homogeneous material once a result equal to or greater than the regulated criteria is detected in any of the samples of that material. All samples of a homogeneous material were analyzed if no asbestos is detected. In some cases, all samples were analyzed in the sample set regardless of result.

Where samples were collected, the analysis was performed in accordance with Test Method EPA/600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials, July 1993.

Where samples were collected, analytical results were compared to the following criteria.



Jurisdiction*	Friable	Non-Friable
Ontario	0.5%	0.5%

Where building materials are described in the report as “non-asbestos” or “does not contain asbestos”, this means that either no asbestos was detected by the analytical method utilized in any of the multiple samples or, if detected, it is below the lower limit of an asbestos-containing material in the applicable regulation. Additionally, these terms are used for materials which historically are known to not include asbestos in their manufacturing.

Asbestos materials were evaluated in order to make recommendations regarding remedial work. The priority for remedial action was based on several factors:

- Friability (friable or non-friable);
- Condition (good, fair, poor, debris);
- Accessibility (ranking from accessible to all building users to inaccessible);
- Visibility (whether the material is obscured by other building components).
- Efficiency of the work (for example, if damaged ACM is being removed in an area, it may be most practical to remove all ACM in the area even if it is in good condition).

For a complete description of the Evaluation Criteria and Basis of Recommendations, refer to Annex A.

METHODOLOGY ANNEX A EVALUATION CRITERIA

EVALUATION CRITERIA AND BASIS OF RECOMMENDATIONS

The detailed asbestos assessment provides information regarding the location, condition, accessibility and friability of the asbestos-containing materials (ACM). In order to make recommendations for compliance with current regulations, Pinchin developed the following criteria.

EVALUATION OF CONDITION

Friable Sprayed or Trowelled Fireproofing, Thermal Insulation and Texture Finishes (Surfacing Materials)

To evaluate the condition of ACM sprayed or trowelled on fireproofing, sprayed or trowelled thermal insulation (non-mechanical), or texture, decorative or acoustic finishes, the following criteria are applied:

Good	Surface of material shows no significant signs of damage, deterioration or delamination. Good condition includes unencapsulated or unpainted fireproofing or texture finishes, where no or limited delamination or damage is observed, or encapsulated fireproofing or texture finishes where the encapsulant or paint has been applied after the damage or fallout occurred.
Poor	A sprayed material that shows signs of significant damage or is significantly delaminating or deteriorating. This may be limited to surface delamination or some portion of the substrate may be exposed.

In Locations where damage exists in isolated areas, both good and poor condition may be applicable. The extent of each condition will be recorded. Fair condition is not utilized in the evaluation of ACM sprayed or trowelled fireproofing, sprayed or trowelled thermal insulation (non-mechanical), or texture, decorative or acoustic finishes.

The evaluation of the above products above ceilings may be limited by the number of observations and by building components such as ducts or full height walls that obstruct the above ceiling observations.

Friable Mechanical or Thermal System Insulation (TSI)

To evaluate the condition of mechanical insulation on vessels, boilers, breeching, ducts, pipes, fan units, equipment etc. the following criteria are applied:

Good	Insulation is completely covered in jacketing and exhibits no evidence of damage or deterioration. No insulation is exposed. Includes conditions where the jacketing has minor damage (i.e. scuffs or stains), but the jacketing is not penetrated.
Fair	Minor penetrating damage to jacketed insulation (cuts, tears, nicks, deterioration or delamination) or undamaged insulation that has never been jacketed. Insulation is exposed but not showing surface disintegration. The extent of missing insulation ranges from minor to none. Damage can be repaired.

Poor	Original insulation jacket is missing, damaged, deteriorated or delaminated. Insulation is exposed and significant areas have been dislodged. Damage cannot be readily repaired. Includes components where insulation may have been removed incompletely.
-------------	---

The evaluation of mechanical insulation may be limited by the number of observations made and building components such as ducts or full height walls that obstruct observations. It is often not possible to observe each foot of mechanical insulation from all angles.

Potentially Friable Materials and Miscellaneous Friable Materials

Potentially friable ACM are products that are basically non-friable while in place but have the potential to generate friable dust upon removal or if significantly disturbed without appropriate procedures. These products may become friable if damaged. Potentially friable materials include materials such as acoustic ceiling tiles and plaster. To evaluate the condition of potentially friable materials, the following criteria are applied:

Good	No significant damage or deterioration. Still serving its intended use as a building material or finish.
Fair	Showing signs of some cracking or breakage, but is not deteriorating (e.g. cracked plaster, broken but in place ceiling tile, missing tile or section of plaster etc.). The condition is such that it is still serving its intended use as a building material or finish but may require repair for mainly cosmetic purposes.
Poor	Significant deterioration or breaking apart of the material. Material has deteriorated to the point it is not serving its intended use as building material or finish. Material has deteriorated to a point it has become friable. Normally potentially friable ACM in Poor condition is not repairable and requires at least localized removal and replacement.

Non-Friable Materials

Non-friable ACM cover a wide range of products with a wide variation in their tendency to release dust or asbestos fibres to the air. Many of these materials, (particularly where the matrix is an unweathered bitumen, asphalt or tar material) do not release fibres except in very unusual circumstances or during significant disturbance (e.g. use of abrasive power tools). Others with a cementitious matrix (asbestos-cement products) can more readily release dust due to abrasion, demolition, weathering, etc. The potential for asbestos release from non-friable ACM is always lower than from friable ACM. To evaluate the condition of non-friable Materials, the following criteria are applied:

Good	No significant damage or deterioration. Still serving its intended use as a building material or finish.
-------------	--

Fair	Showing signs of some cracking or breakage but is not deteriorating (e.g. cracked vinyl floor tile, missing piece of tile or transite, etc.). The condition is such that it is still serving its intended use as a building material or finish but may require repair for mainly cosmetic purposes.
Poor	Significant deterioration or breaking apart of the material to the point at which it cannot be repaired, and it will require at least local removal. Material has deteriorated to the point it is not serving its intended use as building material or finish. Material may have deteriorated to a point where traffic or disturbance may cause it to become friable.

Evaluation of ACM Debris

The identification of the exact location or presence of debris on the top of ceiling tiles is limited by the number of observations made and the presence of building components such as ducts or full height walls that obstruct observations.

The presence of fallen or dislodged ACM is noted separately from the ACM source and is referred to as Debris. Debris may be friable if from a friable ACM source or a badly deteriorated non-friable ACM source. Debris may also be non-friable (such as fallen pieces of transite sheet or mastic fittings, or broken, dislodged floor tiles).

Debris	Debris may be friable or non-friable but is always identified as debris.
---------------	--

Evaluation of Presumed Asbestos-Containing Material (PACM)

Presumed asbestos-containing materials (PACM), are building materials that may contain asbestos but were not sampled or analyzed due to inaccessibility or the need to perform destructive testing to obtain a reasonable sample set. Evaluation of these materials is based on the assumption that these PACM are asbestos-containing.

A list of PACM is provided in the report and they are generally not included in the detailed room by room reports. Typically, they are excluded because they are inaccessible or present in very small quantities. If PACM are evaluated, Pinchin uses the criteria that correspond with the type (and friability) of the material listed above.



EVALUATION OF ACCESSIBILITY

The accessibility of building materials known or suspected of being ACM is rated according to the following criteria:

Access (A)	Common areas of the building within reach of all building users (approximately 8' - 9' from floor or standard ceiling height). Includes other areas where occupant activities may result in disturbance of material that is not normally within reach from floor level, but may be disturbed by common activities (e.g. gymnasiums, workshops, warehouses)
Access (B)	Areas of the building accessed primarily by Maintenance/Caretaking/Janitorial Staff and within reach without use of a ladder. Includes areas within reach in Boiler Rooms, Electrical Rooms, Janitors Closets, Elevator Rooms, Mechanical Rooms, etc. Includes materials within reach from fixed ladders or catwalks, mezzanines, and accessible pipe chases.
Access (C) and Visible	Areas of the building above 8' - 9' where use of a ladder or scaffold is required to reach the ACM. Only includes ACM that are visible to view without the removal or opening of other building components such as ceiling tiles or service access panels. Visible column on HMIS sheets will say YES.
Access (C) and not Visible	Areas of the building above 8' - 9' where use of a ladder or scaffold is required to reach the ACM. Includes ACM that are not visible to view and require the removal of a building component to see, such as ceilings tiles or access panels to view and access. Includes rarely entered crawl spaces, attic spaces, etc. Observations will be limited to the extent visible from the access points. Visible column on HMIS sheets will say NO.
Access (D)	Areas of the building behind inaccessible solid ceiling systems, walls or equipment etc. where demolition of the ceiling, wall or equipment etc. is required to reach the ACM. Material inaccessible due to height or location or is only accessed under unusual situations. Evaluation of condition and extent of ACM is limited or impossible, depending on the surveyor's ability to visually examine materials in Access D.

ACTION MATRIX AND DEFINITIONS

Pinchin's evaluation of the viability of a specific asbestos control option is based on the consideration of the friability, condition, accessibility and visibility of a material. The logic used is that damaged ACM located in an area frequently accessed by all building occupants is of a higher priority than damaged ACM located in an infrequently accessed service area. The action matrix considers the potential for fibre release (primarily from friable ACM) and the possible concerns from regulatory bodies and many building occupants to all damaged ACM (including non-friable).

In any building with asbestos, many current regulations require an Asbestos Management Program be implemented. Depending on the condition and the accessibility, more active measures such as repair or removal may be recommended. The following matrix provides guidance for recommended Actions in the absence of renovation or demolition. In the event of construction or maintenance activity which will disturb ACM more aggressive control or removal will be required.

Action Matrix

The following tables outline the action decisions based on the relationship of assessed factors. Table I applies to friable ACM. Table II applies to non-friable ACM.

Table I Decision Matrix for Friable ACM

Access	Condition			Debris
	Good	Fair	Poor	
(A)	Action 5 ¹	Action 5 ²	Action 3	Action 1
(B)	Action 7	Action 6 ³	Action 3	Action 1
(C) Visible	Action 7	Action 6	Action 3	Action 2
(C) Not Visible	Action 7	Action 7	Action 4	Action 2
(D)	Action 7	Action 7	Action 7	Action 7

Table II Decision Matrix for Potentially Friable and Non-Friable ACM

Access	Condition			Debris
	Good	Fair	Poor	
(A)	Action 7	Action 7 ⁴	Action 3	Action 1
(B)	Action 7	Action 7	Action 3	Action 1
(C) Visible	Action 7	Action 7	Action 4	Action 2
(C) Not Visible	Action 7	Action 7	Action 4	Action 2
(D)	Action 7	Action 7	Action 7	Action 7

Action Definitions

The following are the definitions in the Action Matrix Table presented above:

Action Definitions

Action 1	Clean-Up of ACM Debris Restrict access that is likely to cause a disturbance of the ACM Debris and clean up ACM Debris. Utilize appropriate asbestos precautions.
-----------------	--

¹ If friable ACM in access (A)/Good condition is not proactively removed Action 7 (Manage) is recommended.

² If friable ACM in access (A)/Fair condition is not proactively removed repair is recommended.

³ If friable ACM in access (B)/Fair condition is likely to be disturbed after repair proactive removal is recommended.

⁴ Action 7 is recommended for all non-friable ACM in Fair condition however some clients may wish to repair or take some action primarily for cosmetic reasons

Action Definitions

Action 2	<p>Precautions for Access Which may Disturb ACM Debris</p> <p>Use appropriate means to isolate the debris or to limit entry to the area which may disturb the material. At locations where ACM Debris can remain in place in lieu of removal or clean-up (e.g. Debris on top of ceiling tiles or behind lockable door), Utilize appropriate asbestos precautions to enter the area if this will disturb debris. The precautions will be required until the ACM Debris has been cleaned up.</p>
Action 3	<p>ACM Removal</p> <p>Remove ACM. Utilize asbestos procedures appropriate to the scope of the removal work. Until it is removed, restrict access to the material so it is not disturbed.</p>
Action 4	<p>Precautions for Work Which may Disturb ACM in Poor Condition. Utilize appropriate asbestos precautions if ACM may be disturbed by work on or near ACM. This does not require restricting access to the area, only control of work which may contact or disturb the ACM. Removal is the only viable option if work will disturb ACM.</p>
Action 5	<p>Proactive ACM Removal</p> <p>Remove friable ACM where the presence of friable asbestos in Good condition is not desirable. If friable ACM in Fair condition is not removed, then Repair friable ACM.</p>
Action 6	<p>ACM Repair</p> <p>Repair friable ACM in Fair condition which is not likely to be damaged again or disturbed by normal use of the area or room. Pinchin recommends proactive removal if friable ACM is likely to be damaged or disturbed during normal use of the area or room</p>
Action 7	<p>Asbestos Management Program with Routine Surveillance Implement an Asbestos Management Program, including routine surveillance of ACM. Reassess materials regularly (typically once per year).</p>

APPENDIX IV
Location List

Client: Hamilton-Wentworth Catholic District Sch
Building Name: St Mary Catholic Education Resource Centre
Survey Date: 2018-07-25
Building Phases: A: 1959

Site: 209 MacNab Street North, Hamilton, ON
Last Re-Assessment: 2023-07-20

Location No.	Name or Description	Area ft ²	Floor No.	Bldg. Phase	Notes
0	Presumed Asbestos-Containing Materials	0	0	A	Where present, these materials are assumed to contain asbestos until otherwise proven by sampling and analysis.
1001	Records, room no. 5	0		A	
1002	Records, room no. 7	0		A	
1003	Storage, room no. 8	0		A	
1004	Board Room, room no. 9	0		A	
1005	Mens Washroom	0		A	
1006	Womens Washroom	0		A	
1007	Corridor	0		A	
1008	IT Office, room no. 5	0		A	
1009	Records, room no. 4	0		A	
1010	Community Use Office, room no. 3	0		A	
1011	Office, room no. 2	0		A	
1012	Main Office	0		A	
1013	Corridor	0		A	
1014	Gym Equipment Storage	0		A	
1015	Supply Room	0		A	
1016	Boiler Room	0		A	
1017	IT Department	0		A	
1018	Stairwell 1	0		A	
1019	IT Training Lab	0		A	
1020	Office	0		A	
1021	IT Storage	0		A	
1022	Photo Studio	0		A	
1023	Gymnasium	0		A	
1024	Sink Room	0		A	
1025	Stage	0		A	
1026	Stairwell 3	0		A	
1027	Stairwell 2	0		A	
2001	Offices	0		A	
2002	Washroom	0		A	
2003	Office	0		A	
2004	Office	0		A	
2005	Washroom	0		A	
2006	Office	0		A	
2007	Offices	0		A	
2008	Amalgamated with 2007	0		A	
2009	Corridor	0		A	
2010	Custodian Room	0		A	
2011	Sink Room	0		A	
2012	Girls Washroom	0		A	
2013	Boys Washroom	0		A	
2014	Offices	0		A	
2015	Classroom 4	0		A	
2016	Office, room no. 9	0		A	
2017	Classroom 5	0		A	
2018	Classroom 8	0		A	
2019	Classroom 6	0		A	
2020	Classroom 7 (Joined to 2018)	0		A	
2021	Corridor	0		A	
3001	Classroom 15	0		A	
3002	Classroom 16	0		A	
3003	Classroom 17	0		A	
3004	Boys Washroom	0		A	
3005	Girls Washroom	0		A	
3006	Corridor	0		A	
3007	Classroom 11	0		A	
3008	Classroom 12	0		A	
3009	Classroom 13	0		A	
3010	Classroom 14	0		A	
3011	Womens Washroom	0		A	

Location No.	Name or Description	Area ft ²	Floor No.	Bldg. Phase	Notes
3012	Office	0		A	
3013	OECTA Office	0		A	
3014	Precious Moments Boutique, room no. 1	0		A	
3015	Precious Moments Boutique, room no. 2	0		A	
3016	Storage, room no. 21	0		A	
3017	Sink Room	0		A	

APPENDIX V
Summary Report / Sample Log

Client: Hamilton-Wentworth Catholic District Sch

Site: 209 MacNab Street North, Hamilton, ON

Building Name: St Mary Catholic Education Resource Centre

Survey Date: 2018-07-25

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
Asbestos	V0001	Ceiling Acoustic Tile Ceiling Tiles (lay-in) Mte Sample Id #10466-sm-ct-s01 (sampled 10-apr-10)	1010,1011,1012,1013,1015,1018,1022,1025,1026 1027,3006	A	0	0	0	0	None Detected	No	
Asbestos	V0002	Floor Vinyl Floor Tile (no Mastic) Mte Sample Id #10466-sm-vft-s02	1017,1019,1020,1021	A	0	0	0	0	None Detected	No	
Asbestos	S0003 ABC	Wall Drywall And Joint Compound Mte Sample Id #10466-sm-dwjc-s03 (sampled 10-apr-10)	1011,1017,1019,1020,2014	A	0	0	0	0	None Detected	No	
Asbestos	S0004	Floor Vinyl Floor Tile (no Mastic) Mte Sample Id #10466-sm-vft-s04 (sampled 10-apr-10)	1022,2010	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0005	Floor Vinyl Floor Tile (no Mastic) Mte Sample Id #10466-sm-vft-s05 (sampled 10-apr-10)	1022	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0006	Ceiling Acoustic Tile Ceiling Tiles (lay-in) Mte Sample Id # S0001 (sampled 12-aug-13)	2010	A	0	0	0	0	None Detected	No	
Asbestos	V0008	Floor Vinyl Floor Tile (no Mastic) Mte Sample Id #10466-sm-vft-s08 (sampled 10-apr-10)	1014,3011	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0009	Wall Texture Finish - Non Friable Mte Sample Id #10466-sm-tc-s09 (sampled 10-apr-10)	1011	A	0	0	0	0	None Detected	No	
Asbestos	V0012	Floor Vinyl Floor Tile (no Mastic) Mte Sample Id #10466-sm-vft-s12 (sampled 10-apr-10)	2016	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	V0013	Floor Vinyl Floor Tile (no Mastic) Mte Sample Id #10466-sm-vft-s13 (sampled 10-apr-10)	2016,3009	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	V0014	Floor Vinyl Floor Tile (no Mastic) Mte Sample Id #10466-sm-vft-s14 (sampled 10-apr-10)	2019,3010	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	V0015	Ceiling Drywall And Joint Compound Mte Sample Id #10466-sm-dwjc-s15 (sampled 10-apr-10)	1002,1003,1004,1016,2002,2005	A	0	0	0	0	None Detected	No	
Asbestos	V0017	Floor Vinyl Floor Tile (no Mastic) Mte Sample Id #10466-sm-vft-s17 (sampled 10-apr-10)	2015,3001,3008	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	V0019	Floor Vinyl Floor Tile (no Mastic) Mte Sample Id #10466-sm-vft-s19 (sampled 10-apr-10)	2018,2020	A	0	0	0	0	None Detected	No	
Asbestos	V0021	Floor Vinyl Floor Tile (no Mastic) Mte Sample Id #10466-sm-vft-s21 (sampled 10-apr-10)	3010	A	0	0	0	100	Chrysotile	Yes	NF

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
			10)								
Asbestos	V0022	Other Window Mte Sample Id #10466-sm-caulk-s22 (sampled 10-apr-10)	1001,1002,1004,1005,1008,1009,1010,1011,1016 1022,1023,2013,2015,2016,2017,2018,2019,2020 3001,3002,3003,3004,3007,3008,3009,3010	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	V0025	Floor Vinyl Floor Tile (no Mastic) Mte Sample Id #10466-sm-vft-s25 (sampled 10-apr-10)	2015,3001,3008	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0026	Ceiling Acoustic Tile Ceiling Tiles (lay-in) Pinchin Sample 0001 (sampled 3-aug-18)	1007	A	0	0	0	0	None Detected	No	
Asbestos	S0027 ABC	Piping Parging Cement	1013,1023,2009,2021	A	0	0	57	0	Chrysotile	Yes	F
Asbestos	V9500	Floor Mastic	1001,1002,1003,1004,1008,1009,1010,1011,1012 1014,1017,1019,1020,1021,1022,2001,2002,2003 2004,2005,2006,2007,2010,2014,2015,2016,2017 2018,2019,2020,3001,3002,3003,3007,3008,3009 3010,3011,3012,3013,3014,3015,3016	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Stairs Cement Product	1018,1026,1027	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Light Fixture Foil Face Heat Shield	2002,2005,2006	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other N/a Roofing Felts And Tar, Mastics, Floor Levelling Compound, Ceramic Tile Setting Compound, Electrical Components, Mechanical Packing, Ropes And Gaskets, Vermiculite, Adhesives And Duct Mastics, Caulking And Putties, Fibre-reinforced Paints And Coatings, Paper Products, Soffit And Fascia Boards, Fire Resistant Doors, Stucco, Plaster Or Other Cementitious Parge Coatings, Vibration Dampers On Hvac Equipment, Terrazzo, Ropes And Gaskets In Cast-iron Bell And Spigot Joints, Sealants On Pipe Threads	0	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Door Thermal Insulation Interior Components	1016	A	0	0	0	100	Presumed Asbestos	Yes	F
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tile (mechanically Fastened) 1x1 Small And Large Pinhole	2012	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tile (mechanically Fastened) 1x1 Small And Large Pinhole (particle Board)	1005,1006,1007,1008,1009,1014,1021,1024,2011 2013,2015,2016,2017,2018,2019,2020,3001,3002 3003,3004,3005,3007,3008,3009,3010,3011,3012 3013,3014,3015,3016,3017	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tile (mechanically Fastened) 1x1 Small And Large Pinhole Particle Board	1001	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tiles (lay-in) 2x2 Short Fissure Random Pinhole (installed)	2003,2006,2007	A	0	0	0	0	Non Asbestos	No	

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tiles (lay-in) 2x4 Random Pinhole (installed 2012)	2021	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tiles (lay-in) 2x4 Short Fissure Random Pinhole (installed 2012)	2001,2004,2009	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Tectum	1025	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Carpet	3016	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Ceramic Tiles	1018,1026,1027	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Concrete (poured)	1016	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Terrazzo	1005,1006,1007,1013,1015,1018,1024,1026,1027 2009,2011,2012,2013,2021,3004,3005,3006,3017	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile (no Mastic) 12x12 Brown Multi-fleck (installed 2010)	2004,2007,2014	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile (no Mastic) 12x12 Dark Grey Multi-fleck (installed 2010)	2002,2003,2004,2005,2006,2007,2014	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile (no Mastic) 12x12 Dark Grey Multi-fleck (installed Post 2010)	2001	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile (no Mastic) 12x12 Grey Multi-fleck	1009	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile (no Mastic) 12x12 Grey Multi-fleck (installed Post 2010)	1001,1002,1003,1004,1008,1010,1011,1012,2017 3003,3007,3012,3013,3014,3015,3016	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile (no Mastic) 12x12 White Multi-fleck (installed 2010)	2004,2007,2014	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile (no Mastic) 12x12 Dark Grey With Light Grey Fleck (new)	1022	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile (no Mastic) 12x12 Grey With White And Grey Streak (new)	3002	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Floor Wood	1023,1025	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Piping Fibreglass	1001,1002,1003,1004,1005,1006,1007,1008,1009 1010,1011,1012,1013,1016,1017,1018,1019,1020 1021,1022,1023,1025,1026,1027,2001,2003,2004 2007,2009,2010,2012,2013,2014,2015,2016,2017 2018,2020,3003,3004,3005,3006,3007,3008,3009	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Wall Masonry	1001,1002,1003,1004,1005,1006,1007,1008,1009 1010,1011,1012,1013,1014,1015,1016,1017,1018 1019,1020,1021,1022,1023,1024,1025,1026,1027	A	0	0	0	0	Non Asbestos	No	

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
			2001,2002,2003,2004,2005,2006,2007,2009,2010 2011,2012,2013,2015,2016,2017,2018,2019,2020 2021,3001,3002,3003,3004,3005,3006,3007,3008 3009,3010,3011,3012,3013,3014,3015,3016,3017								

Legend:

Sample number		Units			
S####	Asbestos sample collected	SF	Square feet	NF	Non Friable material.
L####	Paint sample collected	LF	Linear feet	F	Friable material
P####	PCB sample collected	EA	Each	PF	Potentially Friable material
M####	Mould sample collected	%	Percentage		
V####	Material visually similar to numbered sample collected				
V0000	Known non Hazardous Material				
V9000	Material is visually identified as Hazardous Material				
V9500	Material is presumed to be Hazardous Material				
[Loc. No.]	Abated Material				

APPENDIX VI
HMIS All Data Report

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #0 : Presumed Asbestos-Containing Materials **Floor:** 0
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																	
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable	
Other		N/A, Roofing felts and tar, mastics, Floor levelling compound, Ceramic tile setting compound, Electrical components, Mechanical packing, ropes and gaskets, Vermiculite, Adhesives and duct mastics, Caulking and putties, Fibre-reinforced paints and coatings, Paper products, Soffit and fascia boards, Fire resistant doors, Stucco, plaster or other cementitious parge coatings, Vibration dampers on HVAC equipment, Terrazzo, Ropes and gaskets in cast-iron bell and spigot joints, Sealants on pipe threads			D	N		100(7)				%	V9500	Presumed Asbestos		Presumed Asbestos	NF

Where present, these materials are assumed to contain asbestos until otherwise proven by sampling and analysis.

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1001 : Records **Floor:** **Area (sqft):** 0
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education Resource Centre
Room #: 5 **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole Particle Board			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1002 : Records **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: 7 **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0015	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1003 : Storage **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: 8 **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0015	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1004 : Board Room **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: 9 **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0015	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1005 : Mens Washroom **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #:
Area (sqft): 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1006 : Womens Washroom **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1007 : Corridor **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 24x48 Pinholes and Textured			C	Y						S0026	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1008 : IT Office **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: 5 **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1009 : Records **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: 4 **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking						100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1010 : Community Use Office **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: 3
Last Re-Assessment: 2023-07-20

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole			C	Y						V0001	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1011 : Office **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: 2
Last Re-Assessment: 2023-07-20

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole			C	Y						V0001	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						S0003	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Texture Finish - Non Friable		Drywall and joint compound	A	Y						S0009	None Detected		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1012 : Main Office **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole			C	Y						V0001	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1013 : Corridor **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole			C	Y						V0001	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	N		8(7)	2(7)		EA	S0027ABC	Chrysotile	>75%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1014 : Gym Equipment Storage **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Teal with White Streaks			A	Y		95(7)	5(7)		%	V0008	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1015 : Supply Room **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole			C	Y						V0001	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1016 : Boiler Room **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0015	None Detected		None	
Floor		Concrete (poured)			A	Y						V0000	Non-Asbestos		None	
Other	Door	Thermal Insulation, Interior components			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	F
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation		C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1017 : IT Department **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 White w Grey Streak			A	Y						V0002	None Detected		None	
Piping		Fibreglass	Insulation		C	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						S0003A	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1018 : Stairwell 1 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole			C	Y						V0001	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Other	Stairs	Cement Product			C	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1019 : IT Training Lab **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 White w Grey Streak			A	Y						V0002	None Detected		None	
Piping		Fibreglass	Insulation		C	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						S0003B	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1020 : Office **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 White w Grey Streak			A	Y						V0002	None Detected		None	
Piping		Fibreglass	Insulation		C	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						V0003C	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1021 : IT Storage **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 White w Grey Streak			A	Y						V0002	None Detected		None	
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1022 : Photo Studio **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole			C	Y						V0001	None Detected		None	
Floor		Mastic			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Green w Grey Streak		Paint	A	Y		100(7)			%	S0004	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Grey w White Streak		Paint	A	Y		100(7)			%	S0005	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 dark grey with light grey fleck (new)			A	Y		100			%	V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1023 : Gymnasium **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Tectum			C	Y										
Floor		Wood			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		2(7)			EA	V0027	Chrysotile	>75%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1024 : Sink Room **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1025 : Stage **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Tectum			C	N						V0000	Non-Asbestos		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole			C	Y						V0001	None Detected		None	
Floor		Wood			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1026 : Stairwell 3 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole			C	Y						V0001	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Other	Stairs	Cement Product			C	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation		C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #1027 : Stairwell 2 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole			C	Y						V0001	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Other	Stairs	Cement Product			C	N		99(7)	1(7)		%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2001 : Offices **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole (installed 2012)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Dark Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2002 : Washroom **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0015	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Dark Grey Multi-Fleck (installed 2010)			A	Y						V0000	Non-Asbestos		None	
Other	Light Fixture	Foil Face			C	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2003 : Office **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Short Fissure Random Pinhole (installed 2012)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Dark Grey Multi-Fleck (installed 2010)			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2004 : Office **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole (installed 2012)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Dark Grey Multi-Fleck (installed 2010)			A	Y						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Brown Multi-Fleck (installed 2010)			A	Y						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 White Multi-Fleck (installed 2010)			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2005 : Washroom **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0015	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Dark Grey Multi-Fleck (installed 2010)			A	Y						V0000	Non-Asbestos		None	
Other	Light Fixture	Foil Face, Heat Shield			C	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2006 : Office **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Short Fissure Random Pinhole (installed 2012)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Dark Grey Multi-Fleck (installed 2010)			A	Y						V0000	Non-Asbestos		None	
Other	Light Fixture	Foil Face			C	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2007 : Offices **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #:
Last Re-Assessment: 2023-07-20

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Short Fissure Random Pinhole (installed 2012)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Dark Grey Multi-Fleck (installed 2010)			A	Y						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Brown Multi-Fleck (installed 2010)			A	Y						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 White Multi-Fleck (installed 2010)			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2009 : Corridor **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole (installed 2012)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	N		26(7)			EA	V0027	Chrysotile	>75%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2010 : Custodian Room **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Long Fissure Random Pinhole			C	Y						S0006	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Green w White Streak			A	Y		100(7)			%	V0004	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2011 : Sink Room **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2012 : Girls Washroom **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2013 : Boys Washroom **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2014 : Offices **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Dark Grey Multi-Fleck (installed 2010)			A	Y						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Brown Multi-Fleck (installed 2010)			A	Y						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 White Multi-Fleck (installed 2010)			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						V0003	None Detected		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2015 : Classroom 4 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #:
Last Re-Assessment: 2023-07-20

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Cream with Orange Streak			A	Y		100(7)			%	V0017	Chrysotile	5-10%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Orange			A	Y		100(7)			%	V0025	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2016 : Office **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: 9
Last Re-Assessment: 2023-07-20

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Cream with Green Streak			A	Y		100(7)			%	V0012	Chrysotile	5-10%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Green with White Streak			A	Y		100(7)			%	V0013	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2017 : Classroom 5 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2018 : Classroom 8 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Peach Oatmeal			A	Y						V0019	None Detected		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2019 : Classroom 6 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 White w Grey Streak			A	Y		100(7)			%	V0014	Chrysotile	5-10%	Confirmed Asbestos	NF
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2020 : Classroom 7 (Joined to 2018) **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Peach Oatmeal			A	Y						V0019	None Detected		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #2021 : Corridor **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Random Pinhole (installed 2012)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	N		18(7)	1(7)		EA	V0027	Chrysotile	>75%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3001 : Classroom 15 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Cream with Orange Streak			A	Y		100(7)			%	V0017	Chrysotile	5-10%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Orange			A	Y		100(7)			%	V0025	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3002 : Classroom 16 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 grey with white and grey streak (new)			A	Y		100			%	V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3003 : Classroom 17 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3004 : Boys Washroom **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3005 : Girls Washroom **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3006 : Corridor **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2x4 Short Fissure Random Pinhole			C	Y						V0001	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3007 : Classroom 11 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3008 : Classroom 12 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #:
Last Re-Assessment: 2023-07-20 **Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Cream with Orange Streak			A	Y		100(7)			%	V0017	Chrysotile	5-10%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Orange			A	Y		100(7)			%	V0025	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3009 : Classroom 13 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Green w White Streak			A	Y		100(7)			%	V0013	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3010 : Classroom 14 **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Brown with White Streak			A	Y		99(7)	1(7)		%	V0021	Chrysotile	5-10%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 White with Grey Streak			A	Y		100(7)			%	V0014	Chrysotile	5-10%	Confirmed Asbestos	NF
Other	Window	Caulking			A	Y		100(7)			%	V0022	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3011 : Womens Washroom **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Teal with White Streaks			A	Y		100(7)			%	V0008	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3012 : Office **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3013 : OECTA Office **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3014 : Precious Moments Boutique **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: 1 **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3015 : Precious Moments Boutique **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: 2 **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3016 : Storage **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: 21 **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Carpet			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Multi-Fleck (installed post 2010)			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch **Site:** Admin
Location: #3017 : Sink Room **Floor:**
Survey Date: 2018-07-25

Building Name: St Mary Catholic Education
Resource Centre
Room #: **Area (sqft):** 0
Last Re-Assessment: 2023-07-20

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tile (mechanically fastened), 1x1 Small and Large Pinhole (particle board)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Legend:



Sample number		Units		Other	
S####	Asbestos sample collected	SF	Square feet	A	Access
V####	Material visually similar to numbered sample collected	LF	Linear feet	V	Visible
V0000	Known non-asbestos material	EA	Each	AP	Air Plenum
V9000	Visually identified as an asbestos material	%	Percentage	F	Friable material
V9500	Material is presumed to be an asbestos material			NF	Non Friable material
				PF	Potentially Friable material

Access	
A	Accessible to all building occupants
B	Accessible to maintenance and operations staff without a ladder
C	Accessible to maintenance and operations staff with a ladder. Also rarely entered, locked areas
D	Not normally accessible

Condition	
Good	No visible damage or deterioration
Fair	Minor, repairable damage, cracking, delamination or deterioration
Poor	Irreparable damage or deterioration with exposed and missing material

Visible	
Y	The material is visible when standing on the floor of the room, without the removal or opening of other building components (e.g. ceiling tiles or access panels).
N	The material is not visible to view when standing on the floor of the room and requires the removal of a building component (e.g. ceilings tiles or access panels) to view and access. Includes rarely entered crawlspaces, attic spaces, etc. Observations will be limited to the extent visible from the access points.

Air Plenum	
Yes or No	The material is in a return air plenum or in a direct airstream or there is evidence of air erosion (e.g. duct for heating or cooling blowing directly on or across an ACM). This field is only completed where Air Plenum consideration is required by regulation.

Colour Coding	
	The material is known to contain regulated concentrations of asbestos; either by analytical results or visible identification (use of the V9000 code).
	The material is presumed to contain asbestos; based on visual appearances; typically a material known to historically contain asbestos; however, not sampled due to limited access or the destructive nature of the sampling.

Action					
(1)	Clean up of ACM Debris	(2)	Precautions for Access Which may Disturb ACM Debris	(3)	ACM removal
(4)	Precautions for Work Which may Disturb ACM in Poor Condition	(5)	Proactive ACM removal (Minimum repair required for fair condition)	(6)	ACM repair
(7)	Management program and surveillance				