



## **Asbestos Assessment**

St. Jean de Brebeuf  
200 Acadia Drive, Hamilton, ON,  
L8W 1B8

Prepared for:

**Hamilton-Wentworth Catholic  
District School Board**

90 Mulberry Street  
Hamilton, Ontario, L8N 3R9

August 31, 2023

Pinchin File: 320582.004



**Asbestos Assessment**

St. Jean de Brebeuf, 200 Acadia Drive, Hamilton, ON, L8W 1B8  
Hamilton-Wentworth Catholic District School Board

August 31, 2023  
Pinchin File: 320582.004

**Issued to:** Hamilton-Wentworth Catholic District School Board  
**Issued on:** August 31, 2023  
**Pinchin File:** 320582.004  
**Issuing Office:** Hamilton, ON  
**Primary Contact:** Emily Balfour, Project Manager, [ebalfour@pinchin.com](mailto:ebalfour@pinchin.com)

---

Author:

---

Emily Balfour  
Project Manager  
365.889.5147  
[ebalfour@pinchin.com](mailto:ebalfour@pinchin.com)

Reviewer:

---

Damian Palus, C.E.T.  
Operations Manager  
289.678.0694  
[dpalus@pinchin.com](mailto:dpalus@pinchin.com)



## **EXECUTIVE SUMMARY**

Hamilton-Wentworth Catholic District School Board (Client) retained Pinchin Ltd. (Pinchin) to conduct an asbestos building materials assessment of St. Jean de Brebeuf located at 200 Acadia Drive, Hamilton, ON, L8W 1B8.

The objectives of the assessment were to document the locations of asbestos building materials, evaluate their condition and develop corrective action plans as required for the purposes of long-term management. The results of this assessment are not intended for construction, renovation, demolition or project tendering purposes.

## **SUMMARY OF RECOMMENDATIONS**

The following is a summary of significant recommendations; refer to the body of the report for detailed recommendations:

1. Maintain the Asbestos Management Program (AMP)
2. Perform a re-assessment of asbestos materials on an annual basis.
3. Perform a pre-construction assessment and remove all ACM prior to alteration or maintenance work if ACM may be disturbed by the work.
4. Follow appropriate safe work procedures when handling or disturbing asbestos.
5. Sample any presumed ACM prior to alteration or maintenance work if presumed ACM may be disturbed by the work.
6. Update the asbestos inventory report upon completion of any abatement and removal of asbestos-containing materials.

*This Executive Summary is subject to the same standard limitations as contained in the report and must be read in conjunction with the entire report.*



## TABLE OF CONTENTS

1.0	INTRODUCTION AND SCOPE .....	1
1.1	Scope of Assessment .....	1
2.0	METHODOLOGY .....	1
3.0	BACKGROUND INFORMATION .....	1
3.1	Building Year of Construction and Additions .....	1
3.2	Existing Reports .....	1
3.3	Inaccessible Locations .....	2
4.0	FINDINGS .....	2
4.1	Excluded Asbestos Materials .....	2
4.2	Summary of Building Materials .....	3
5.0	RECOMMENDATIONS .....	7
5.1	General .....	7
5.2	Remedial Work .....	8
5.3	On-going Management and Maintenance .....	8
6.0	TERMS AND LIMITATIONS .....	8
7.0	REFERENCES .....	9

## APPENDICES

APPENDIX I	Drawings
APPENDIX II	Asbestos Analytical Certificates
APPENDIX III	Methodology
APPENDIX IV	Location List
APPENDIX V	Summary Report / Sample Log
APPENDIX VI	HMIS All Data Report



## 1.0 INTRODUCTION AND SCOPE

Hamilton-Wentworth Catholic District School Board (Client) retained Pinchin Ltd. (Pinchin) to conduct an asbestos building materials assessment of St. Jean de Brebeuf located at 200 Acadia Drive, Hamilton, ON, L8W 1B8.

Pinchin performed the assessment on August 1, 2023.

The objectives of the assessment were to document the locations of asbestos building materials, evaluate their condition and develop corrective action plans as required. This assessment is only to be used for the purposes of long-term management and routine maintenance. The results of this assessment are not to be used for construction, renovation, demolition, or project tendering purposes.

### 1.1 Scope of Assessment

The assessment was performed to establish the location and type of asbestos building materials incorporated in the structure(s) and its finishes. The **assessed area** consisted of all parts of the building, excluding the roof.

## 2.0 METHODOLOGY

Pinchin conducted a room-by-room assessment (rooms, corridors, service areas, exterior, etc.) to identify the asbestos-containing building materials as defined in the scope.

The assessment was limited to non-intrusive testing. Concealed spaces such as those above solid ceilings and within shafts and pipe chases were accessed via existing access panels only. Demolition of walls, solid ceilings, structural items, interior finishes or exterior building finishes, to determine the presence of concealed materials was not conducted.

For further details on the methodology including test methods, refer to Appendix III.

## 3.0 BACKGROUND INFORMATION

### 3.1 Building Year of Construction and Additions

Item	Details
Year of Construction	1973
Year(s) of Additions	1999, 2018

### 3.2 Existing Reports

Pinchin previously prepared the following report, which has been reviewed as part of this assessment:



- Asbestos Reassessment Report, St. Jean de Brebeuf, August 2022, Pinchin File No. 303992.004.

### **3.3 Inaccessible Locations**

Inaccessible locations (rooms or areas), if any, are indicated in the Location List Report in Appendix IV. These locations within the assessed area were not accessible to the surveyor and are therefore not included in the report.

## **4.0 FINDINGS**

The following section summarizes the findings of the assessment and provides a general description of the asbestos-containing materials (ACM) identified and their locations. For details on approximate quantities, condition, friability, accessibility and locations of asbestos materials; refer to the Asbestos Material Summary Report and All Data Report in Appendix V and VI.

### **4.1 Excluded Asbestos Materials**

A number of materials which might contain asbestos were not sampled during this assessment due to limitations in scope and methodology. Where present, these materials are assumed to contain asbestos until otherwise proven by sampling and analysis. These materials are not shown on the drawings in Appendix I. Excluded materials presumed to contain asbestos include:

- Roofing felts and tar, mastics
- Floor levelling compound
- Ceramic tile setting compound
- Elevator and lift brakes
- Electrical components
- Moulded plastic components (laboratory bench tops)
- Mechanical packing, ropes and gaskets
- Vermiculite
- Adhesives and duct mastics
- Caulking and putties
- Fibre-reinforced paints and coatings
- Paper products
- Soffit and fascia boards
- Fire resistant doors


- Stucco, plaster or other cementitious parge coatings
- Vibration dampers on HVAC equipment
- Terrazzo
- Ropes and gaskets in cast-iron bell and spigot joints
- Sealants on pipe threads






**4.2 Summary of Building Materials**

This section includes a summary of building materials that have been confirmed asbestos-containing by sample analysis, presumed asbestos-containing by visual identification, or confirmed non-asbestos by sampling or based on the manufacture date and known end of use of asbestos in these products.


The locations of samples from historical assessments performed by Pinchin, have been included on the drawings.



Appendix II presents the asbestos bulk sample analytical results.



Material and Application	Asbestos Type	Photo
Fireproofing is present on structural steel including beams, trusses, joists, corrugated steel deck, concrete deck, columns.	None	
<p>Texture finish is present on plaster ceilings in the Chapel (Location 1055).</p> <p>Texture finish is also present on the soffit in the Hallway (Location 1041).</p> <p>Overspray from the asbestos-containing texture coat is presumed to be present above the ceiling at light fixture openings, on the deck, ducts and within junction boxes.</p>	Chrysotile	

Material and Application	Asbestos Type	Photo
<p>Parging cement is present on pipe fittings (elbows, valves, tees, hangers etc.) and over sweatwrap on pipe straights.</p>	<p>Chrysotile</p>	
<p>A white corrugated paper insulation (trade name Aircell), containing chrysotile asbestos, is present on straight sections of domestic water and heating system pipes.</p>	<p>Chrysotile</p>	
<p>Remaining pipes are either uninsulated or insulated with non-asbestos fiberglass or elastomeric insulation (Armaflex).</p>	<p>None</p>	
<p>Ducts are presumed to be insulated with fiberglass and parging cement in the Gymnasium (Location 1100) but were not confirmed due to the elevated height of the material.</p>	<p>Presumed</p>	
<p>Remaining ducts are either uninsulated or insulated with non-asbestos fiberglass (foil-faced or canvas).</p>	<p>None</p>	



Material and Application	Asbestos Type	Photo
Mechanical equipment is either uninsulated or insulated with non-asbestos fibreglass.	None	
All ceiling tiles are non-asbestos from previous sampling or presumed to be non-asbestos based on the date of manufacture determined from the date stamp applied to the top of the tiles.	None	
Smooth plaster is present on walls and ceilings.	None	
Drywall joint compound is present on wall and ceiling finishes.	None	
Asbestos in drywall joint compound was banned in Canada in 1980. The 2018 addition was constructed after 1986 (1980 plus a reasonable non-compliance period based on our experience) and the drywall joint compound is assumed to contain no asbestos.	None	
Transite pipe is present as rain water leaders.	Presumed	
Transite board is present in fume hoods and acid/base storage cabinets.	Presumed	

Material and Application	Asbestos Type	Photo
<p>Vinyl floor tiles, 9"x9" and 12"x12", various colours, are present.</p>	<p>Presumed (tile) Chrysotile/Presumed (mastic)</p>	
<p>Remaining vinyl floor tiles are presumed to be non-asbestos based on historical knowledge of the date of installation or confirmed non-asbestos based on previous sampling.</p> <p>Mastic under non-asbestos tiles is presumed to contain asbestos until further sampling is performed.</p>	<p>None (tile) Presumed (mastic)</p>	
<p>Vinyl floor tiles and mastic in the 2018 addition are presumed to be non-asbestos based on historical knowledge of the date of installation.</p>	<p>None</p>	
<p>Foil faced heat shield paper is present in incandescent light fixtures.</p>	<p>Chrysotile</p>	

Material and Application	Asbestos Type	Photo
Bakelite is present as sinks and countertops.	Presumed	
Caulking, in various colours, is present throughout the exterior of the building around window frames, louvers, and expansion joints.	Chrysotile	
Gold mastic is present as a sink undercoating.	Presumed	

Additional notes on the caulking discussed above:

- Caulking was collected and analyzed during a project-specific assessment. Remaining caulking in the building was not included in this assessment due to limitations in scope and methodology. Where present, other caulking not sampled is assumed to contain asbestos until otherwise proven by sampling and analysis.

## 5.0 RECOMMENDATIONS

### 5.1 General

Perform a detailed intrusive assessment prior to maintenance work, building renovation or demolition operations. The assessment should include destructive testing (e.g., coring and/or removal of building finishes and components), and other hazardous materials (lead, mercury, PCBs, mould, etc.) and materials not tested in this study (e.g., roofing materials, caulking, mastics).



## **5.2 Remedial Work**

No remedial work is recommended.

## **5.3 On-going Management and Maintenance**

The following recommendations are made regarding on-going management and maintenance work involving the asbestos materials identified.

Maintain the Asbestos Management Program (AMP).

Perform a reassessment of asbestos materials on an annual basis.

Remove asbestos-containing materials (ACM) prior to alteration or maintenance work if ACM may be disturbed by the work. Follow appropriate asbestos precautions for the classification of work being performed.

Sample presumed ACM prior to alteration or maintenance work if the presumed ACM may be disturbed by the work.

Update the asbestos inventory report upon completion of any abatement and removal of asbestos-containing materials.

## **6.0 TERMS AND LIMITATIONS**

This work was performed subject to the Terms and Limitations presented or referenced in the proposal for this project.

Information provided by Pinchin is intended for Client use only. Pinchin will not provide results or information to any party unless disclosure by Pinchin is required by law. Any use by a third party of reports or documents authored by Pinchin or any reliance by a third party on or decisions made by a third party based on the findings described in said documents, is the sole responsibility of such third parties. Pinchin accepts no responsibility for damages suffered by any third party as a result of decisions made or actions conducted. No other warranties are implied or expressed.



## 7.0 REFERENCES

The following legislation and documents were referenced in completing the assessment and this report:

1. Asbestos on Construction Projects and in Buildings and Repair Operations, Ontario Regulation 278/05.
2. Designated Substances, Ontario Regulation 490/09.
3. Ministry of the Environment Regulation, R.R.O. 1990 Reg. 347 as amended.

\\PIN-HAM-FS02\job\320000s\0320582.000 HWCDSB,Various2023Projects,ASB,CONS\0320582.004 HWCDSB,AllSites,2023,ASB,ASSMT\Deliverables\St. Jean de Brebeuf\Deliverables\320582.004 Asbestos Asmnt Report St. Jean de Brebeuf HWCDSB Aug 31 2023.docx


Template: Master Report for Asbestos Assessment, HAZ, July 29, 2021

**APPENDIX I**  
**Drawings**

NOT ALL KNOWN OR SUSPECTED ASBESTOS BUILDING MATERIALS MAY BE DEPICTED ON THE DRAWING. REFER TO THE ASBESTOS REASSESSMENT REPORT FOR A COMPLETE LIST OF KNOWN AND SUSPECTED ASBESTOS BUILDING MATERIALS.

LEGEND IS COLOUR DEPENDENT. NON-COLOUR COPIES MAY ALTER INTERPRETATION.

BASE PLAN PROVIDED BY CLIENT.

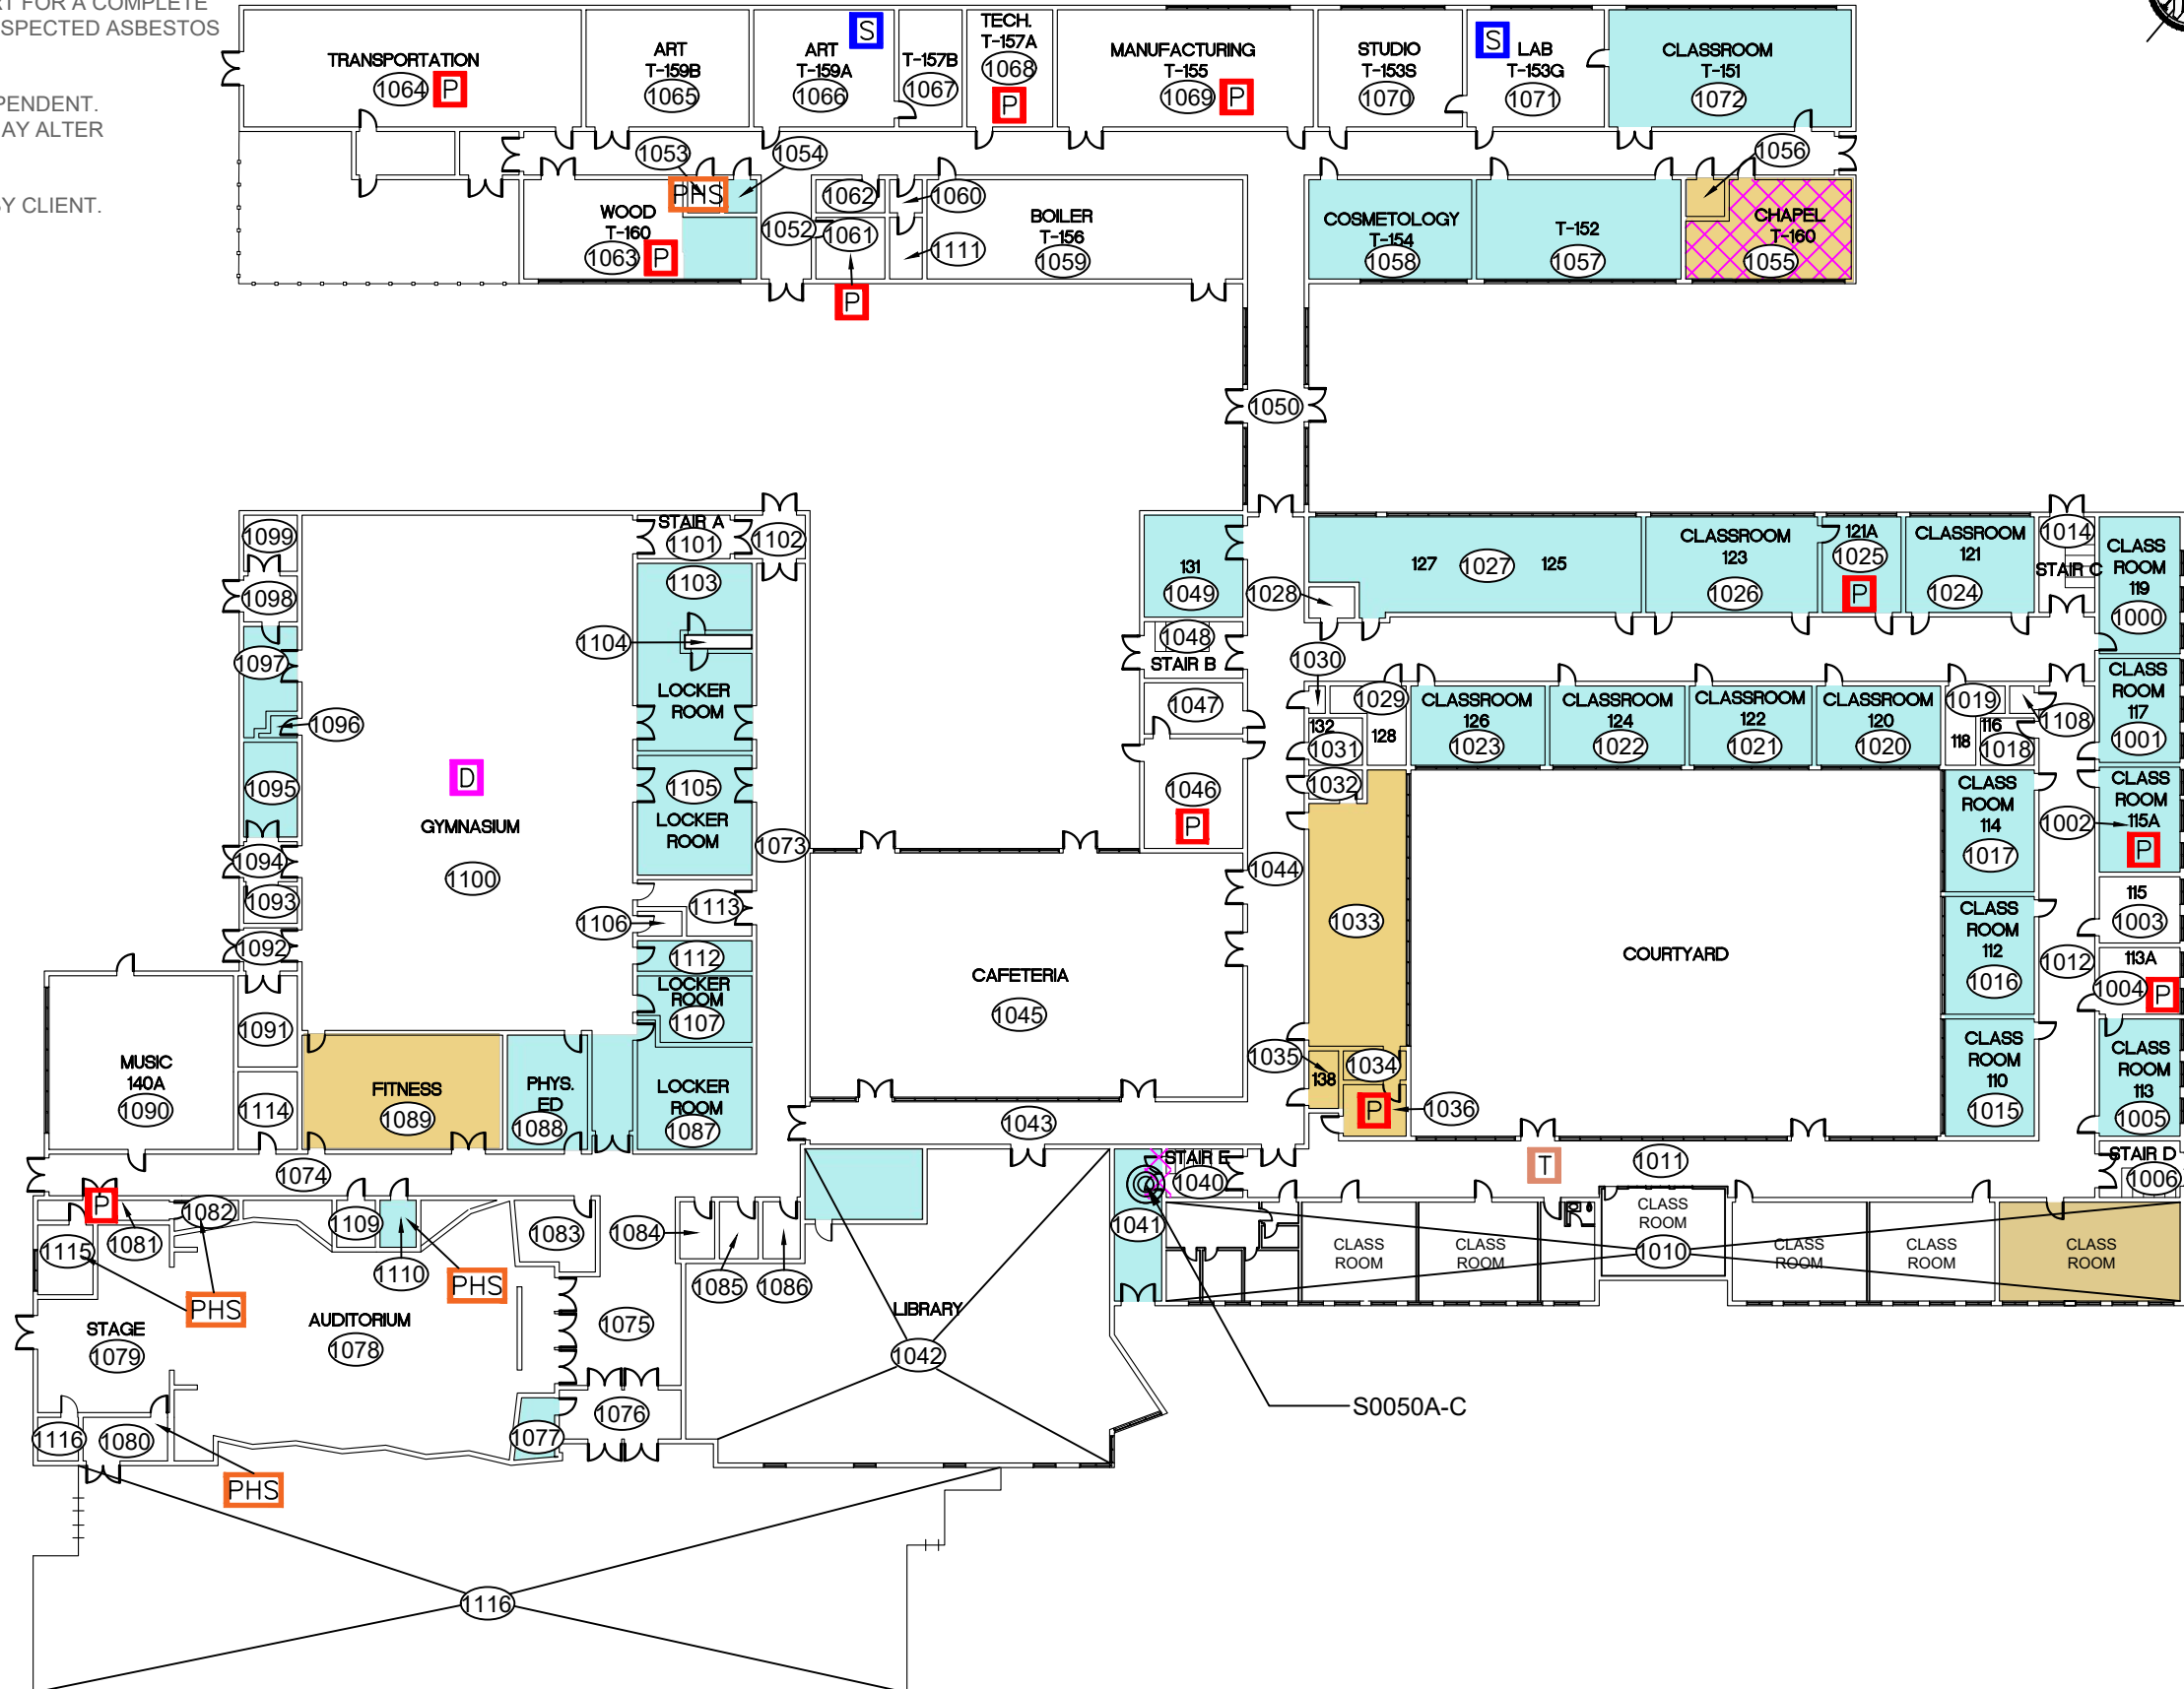

905-577-6206 [www.pinchin.com](http://www.pinchin.com)

LEGEND:

- (X) LOCATION NUMBER
- (C) ASBESTOS BULK SAMPLES
- ASBESTOS-CONTAINING MATERIALS:**
- P** PIPE INSULATION
- T** TRANSITE
- B** BAKELITE
- S** SINK UNDERCOATING
- D** PRESUMED DUCT INSULATION
- PHS** PAPER HEAT SHIELD
- TEXTURE FINISH
- VINYL FLOOR TILES & MASTIC
- FLOOR MASTIC
- VINYL SHEET FLOORING

CLIENT:



LOCATION:

ST. JEAN DE BREBEUF  
200 ACADIA DRIVE  
HAMILTON, ONTARIO

TITLE:

ASBESTOS ASSESSMENT  
FLOOR LEVEL 1

DATE:

AUGUST 2023

PROJECT #:

320582.004

DRAWN BY:

EB

CHECKED BY:

EB

SCALE:

NTS

DRAWING:

1 OF 2

NOT ALL KNOWN OR SUSPECTED ASBESTOS BUILDING MATERIALS MAY BE DEPICTED ON THE DRAWING. REFER TO THE ASBESTOS REASSESSMENT REPORT FOR A COMPLETE LIST OF KNOWN AND SUSPECTED ASBESTOS BUILDING MATERIALS.

LEGEND IS COLOUR DEPENDENT. NON-COLOUR COPIES MAY ALTER INTERPRETATION.

BASE PLAN PROVIDED BY CLIENT.



905-577-6206

www.pinchin.com

LEGEND:

(X) LOCATION NUMBER

(◎) ASBESTOS BULK SAMPLES

ASBESTOS-CONTAINING MATERIALS:

(P) PIPE INSULATION

(T) TRANSITE

(B) BAKELITE

(S) SINK UNDERCOATING

(D) PRESUMED DUCT INSULATION

(PHS) PAPER HEAT SHIELD

(X) TEXTURE FINISH

(Light Blue) VINYL FLOOR TILES & MASTIC

(Yellow) FLOOR MASTIC

(Pink) VINYL SHEET FLOORING

CLIENT:



Hamilton-Wentworth  
Catholic District School Board

*Believing, Achieving, Serving*

LOCATION:

ST. JEAN DE BREBEUF  
200 ACADIA DRIVE  
HAMILTON, ONTARIO

TITLE:

ASBESTOS ASSESSMENT  
FLOOR LEVEL 2

DATE:

AUGUST 2023

PROJECT # :

320582.004

DRAWN BY:

EB

DRAWING:


2 OF 2

CHECKED BY:

EB

SCALE:

NTS

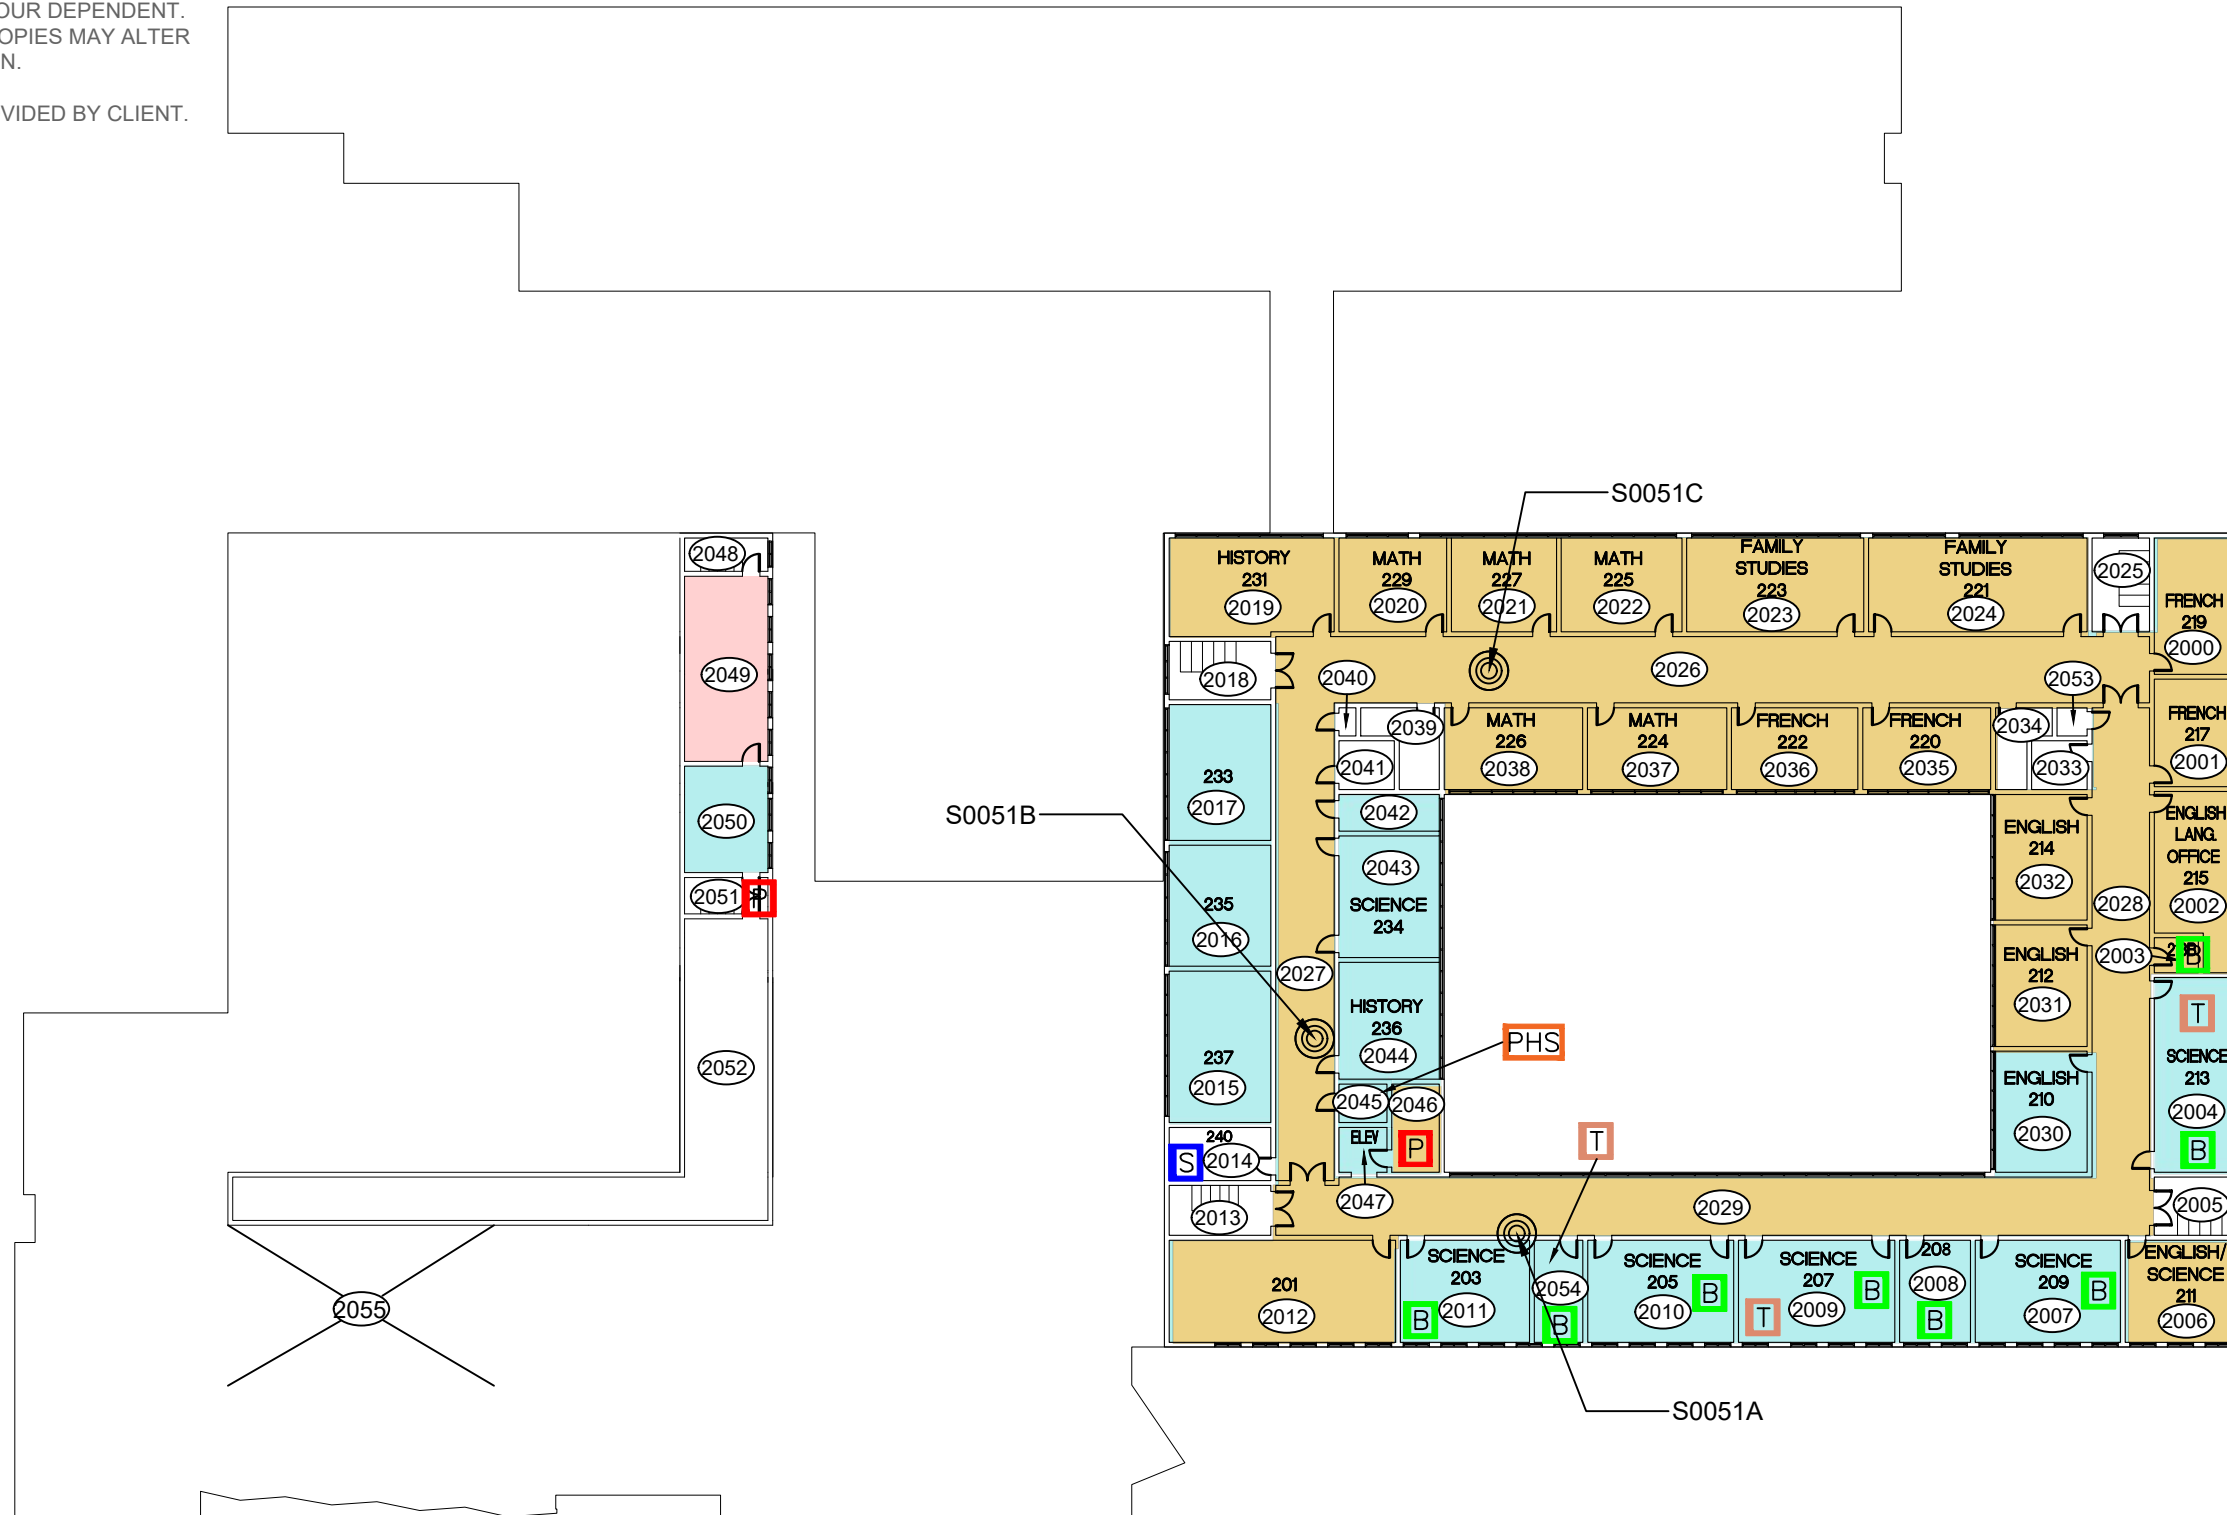



**APPENDIX II**  
**Asbestos Analytical Certificates**



# Bulk Asbestos Analysis

By Polarized Light Microscopy  
 EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,  
 App.E



**Customer:** Pinchin Ltd.  
 6-875 Main St West  
 Suite 200  
 Hamilton, Ontario L8S 4P9

**Project:** 224334 St Jean de Brebeuf

**Attn:** Leslie Cantar

**Lab Order ID:** 51820602  
**Analysis ID:** 51820602\_PLM  
**Date Received:** 8/13/2018  
**Date Reported:** 8/22/2018

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
S0039A	Aircell, Loc: 1064, Transportation	5% Chrysotile	90% Cellulose	5% Other	Gray Fibrous Homogeneous
51820602PLM_1					Ashed, Teased
S0039B	Aircell, Loc: 1064, Transportation	Not Analyzed			
51820602PLM_2					
S0039C	Aircell, Loc: 1064, Transportation	Not Analyzed			
51820602PLM_3					
S0040A	24"x48" lay-in, random width-wise fissures, Loc: 1070, Studio T-153S	None Detected	50% Fiber Glass 30% Cellulose	10% Perlite 10% Other	White, Gray Fibrous Homogeneous
51820602PLM_4					Ashed, Teased
S0040B	24"x48" lay-in, random width-wise fissures, Loc: 1070, Studio T-153S	None Detected	50% Mineral Wool 30% Cellulose	10% Perlite 10% Other	White, Gray Fibrous Homogeneous
51820602PLM_5					Ashed, Teased
S0040C	24"x48" lay-in, random width-wise fissures, Loc: 1070, Studio T-153S	None Detected	50% Fiber Glass 30% Cellulose	10% Perlite 10% Other	White, Gray Fibrous Homogeneous
51820602PLM_6					Ashed, Teased

**Disclaimer:** Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAL. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Bethany Nichols (6)

Analyst

Approved Signatory

51820602

Version 1-15-2012

**Client:** Pinchin Ltd.  
**Contact:** Leslie Cantar  
**Address:** 6-875 Main St W, Hamilton, ON  
**Phone:** 280.237.4294  
**Fax:** 905.577.6207  
**Email:** [lcantar@pinchin.com](mailto:lcantar@pinchin.com)

**Project:** 224334 St Jean de Brebeuf  
 Stop positive on all samples.

**Client Notes:**

**P.O. #:** 224334 (SJB)  
**Date Submitted:** 08-09-2018

**Analysis:** PLM BULK EPA 600  
**TurnAroundTime:** 6+ days

**\*Instructions:**  
 Use Column "B" for your contact info

To See an Example Click the  
 bottom Example Tab.

63

**Begin Samples with a "<<" above the first sample  
 and end with a ">>" below the last sample.  
 Only Enter your data on the first sheet "Sheet1"**

Note: Data 1 and Data 2 are optional  
 fields that do not show up on the official  
 report, however they will be included  
 in the electronic data returned to you  
 to facilitate your reintegration of the report data.

Scientific  
 Analytical  
 Institute



**4604 Dundas Dr.  
 Greensboro, NC 27407  
 Phone: 336.292.3888  
 Fax: 336.292.3313  
 Email: [lab@sailab.com](mailto:lab@sailab.com)**

Sample Number	Data 1 (Lab use only)	Sample Description	Data 2 (Lab use only)
<<			
S0039A		Aircell,Loc:1064,Transportation	
S0039B		Aircell,Loc:1064,Transportation	
S0039C		Aircell,Loc:1064,Transportation	
S0040A		24"x48" lay-in, random width-wise fissures,Loc:1070, Studio T-153S	
S0040B		24"x48" lay-in, random width-wise fissures,Loc:1070, Studio T-153S	
S0040C		24"x48" lay-in, random width-wise fissures,Loc:1070, Studio T-153S	
>>			

Accepted


Rejected

*K. Havelin*  
 8/13/18  
 10:30am



# Bulk Asbestos Analysis

By Polarized Light Microscopy  
 EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,  
 App.E

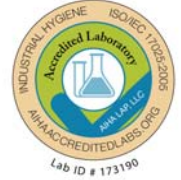

**Customer:** Pinchin Ltd.  
 6-875 Main St West  
 Suite 200  
 Hamilton, Ontario L8S 4P9

**Attn:** Stephen Holmquist  
 Leslie Cantar

**Lab Order ID:** 71915215  
**Analysis ID:** 71915215\_PLM  
**Date Received:** 6/7/2019  
**Date Reported:** 6/12/2019  
**Date Amended:** 6/12/2019

**Project:** 243241.004,200 Acadia Drive, Hamilton, Ontario, Hamilton-Wentworth Catholic District School Board, St. Jean de Brebeuf

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
0041A	Caulking on panels below window, grey, exterior	<b>None Detected</b>		<b>100% Other</b>	Gray Non Fibrous Heterogeneous
71915215PLM_1					Dissolved
0041B	Caulking on panels below window, grey, exterior	<b>1% Chrysotile</b>		<b>99% Other</b>	Gray, Black Non Fibrous Heterogeneous
71915215PLM_2					Dissolved
0041C	Caulking on panels below window, grey, exterior	<b>Not Analyzed</b>			
71915215PLM_3					
0042A - A	Plaster ceiling, Location 1004	<b>5% Chrysotile</b>		<b>95% Other</b>	White Fibrous Heterogeneous
71915215PLM_4	insulation - small sample				Teased
0042A - B	Plaster ceiling, Location 1004	<b>None Detected</b>		<b>100% Other</b>	White Non Fibrous Heterogeneous
71915215PLM_32	finish				Crushed
0042A - C	Plaster ceiling, Location 1004	<b>&lt; 0.5% Libby Amphibole</b>		<b>100% Other</b>	Tan Non Fibrous Heterogeneous
71915215PLM_33	base				Crushed
0042B - A	Plaster ceiling, Location 1001	<b>None Detected</b>		<b>100% Other</b>	White Non Fibrous Homogeneous
71915215PLM_5	finish				Crushed
0042B - B	Plaster ceiling, Location 1001	<b>None Detected</b>		<b>100% Other</b>	Gray Non Fibrous Heterogeneous
71915215PLM_34	base				Crushed

**Disclaimer:** Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAL. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (39)


Analyst

Approved Signatory



# Bulk Asbestos Analysis

By Polarized Light Microscopy  
 EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,  
 App.E

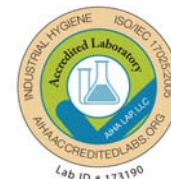

**Customer:** Pinchin Ltd.  
 6-875 Main St West  
 Suite 200  
 Hamilton, Ontario L8S 4P9

**Attn:** Stephen Holmquist  
 Leslie Cantar

**Lab Order ID:** 71915215  
**Analysis ID:** 71915215\_PLM  
**Date Received:** 6/7/2019  
**Date Reported:** 6/12/2019  
**Date Amended:** 6/12/2019

**Project:** 243241.004,200 Acadia Drive, Hamilton, Ontario, Hamilton-Wentworth Catholic District School Board, St. Jean de Brebeuf

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
0042C - A	Plaster ceiling, Location 1025	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_6	finish				Crushed
0042C - B	Plaster ceiling, Location 1025	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_35	base				Crushed
0042D - A	Plaster ceiling, Location 1023	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_7	finish				Crushed
0042D - B	Plaster ceiling, Location 1023	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_36	base				Crushed
0042E - A	Plaster ceiling, Location 2012	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_8	finish				Crushed
0042E - B	Plaster ceiling, Location 2012	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_38	base				Crushed
0042F - A	Plaster ceiling, Location 2001	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_9	finish				Crushed
0042F - B	Plaster ceiling, Location 2001	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_39	base				Crushed

**Disclaimer:** Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAL. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (39)


Analyst

Approved Signatory



# Bulk Asbestos Analysis

By Polarized Light Microscopy  
 EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,  
 App.E

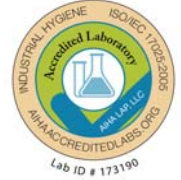

**Customer:** Pinchin Ltd.  
 6-875 Main St West  
 Suite 200  
 Hamilton, Ontario L8S 4P9

**Attn:** Stephen Holmquist  
 Leslie Cantar

**Lab Order ID:** 71915215  
**Analysis ID:** 71915215\_PLM  
**Date Received:** 6/7/2019  
**Date Reported:** 6/12/2019  
**Date Amended:** 6/12/2019

**Project:** 243241.004,200 Acadia Drive, Hamilton, Ontario, Hamilton-Wentworth Catholic District School Board, St. Jean de Brebeuf

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
0042G - A	Plaster ceiling, Location 2043	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_10	finish				Crushed
0042G - B	Plaster ceiling, Location 2043	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_37	base				Crushed
0043A	Caulking around window, white, Location 1002	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_11					Dissolved
0043B	Caulking around window, white, Location 1002	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_12					Dissolved
0043C	Caulking around window, white, Location 1002	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_13					Dissolved
0044A	Caulking on expansion joints, white, courtyard	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_14					Dissolved
0044B	Caulking on expansion joints, white, courtyard	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_15					Dissolved
0044C	Caulking on expansion joints, white, courtyard	1% Chrysotile		99% Other	Gray Non Fibrous Heterogeneous
71915215PLM_16					Dissolved

**Disclaimer:** Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAL. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (39)


Analyst

Approved Signatory



# Bulk Asbestos Analysis

By Polarized Light Microscopy  
 EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,  
 App.E

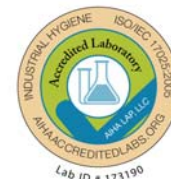

**Customer:** Pinchin Ltd.  
 6-875 Main St West  
 Suite 200  
 Hamilton, Ontario L8S 4P9

**Attn:** Stephen Holmquist  
 Leslie Cantar

**Lab Order ID:** 71915215  
**Analysis ID:** 71915215\_PLM  
**Date Received:** 6/7/2019  
**Date Reported:** 6/12/2019  
**Date Amended:** 6/12/2019

**Project:** 243241.004,200 Acadia Drive, Hamilton, Ontario, Hamilton-Wentworth Catholic District School Board, St. Jean de Brebeuf

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
0045A	Caulking within window frame, off-white, courtyard	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_17					Dissolved
0045B	Caulking within window frame, off-white, courtyard	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_18					Dissolved
0045C	Caulking within window frame, off-white, courtyard	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_19					Dissolved
0046A	Caulking around louvers, black/grey, courtyard	2% Chrysotile		98% Other	Black, Gray Non Fibrous Heterogeneous
71915215PLM_20					Dissolved
0046B	Caulking around louvers, black/grey, courtyard	Not Analyzed			
71915215PLM_21					
0046C	Caulking around louvers, black/grey, courtyard	Not Analyzed			
71915215PLM_22					
0047A	Puck mastic, brown, Location 1023	None Detected		100% Other	Brown Non Fibrous Heterogeneous
71915215PLM_23					Dissolved
0047B	Puck mastic, brown, Location 1023	None Detected		100% Other	Brown Non Fibrous Heterogeneous
71915215PLM_24					Dissolved

**Disclaimer:** Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAL. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (39)

Analyst


Approved Signatory





# Bulk Asbestos Analysis

By Polarized Light Microscopy  
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,  
App.E

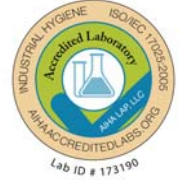

**Customer:** Pinchin Ltd.  
6-875 Main St West  
Suite 200  
Hamilton, Ontario L8S 4P9

**Attn:** Stephen Holmquist  
Leslie Cantar

**Lab Order ID:** 71915215  
**Analysis ID:** 71915215\_PLM  
**Date Received:** 6/7/2019  
**Date Reported:** 6/12/2019  
**Date Amended:** 6/12/2019

**Project:** 243241.004,200 Acadia Drive, Hamilton, Ontario,Hamilton-Wentworth Catholic  
District School Board,St. Jean de Brebeuf

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
0047C	Puck mastic, brown, Location 1023	None Detected		100% Other	Brown Non Fibrous Heterogeneous
71915215PLM_25					Dissolved
0048A	Caulking on window sill, grey, exterior of Location 2010	3% Chrysotile		97% Other	Gray Non Fibrous Heterogeneous
71915215PLM_26					Dissolved
0048B	Caulking on window sill, grey, exterior of Location 2010	Not Analyzed			
71915215PLM_27					
0048C	Caulking on window sill, grey, exterior of Location 2010	Not Analyzed			
71915215PLM_28					
0049A	Caulking at window frame, grey, exterior	3% Chrysotile		97% Other	Gray Non Fibrous Heterogeneous
71915215PLM_29					Dissolved
0049B	Caulking at window frame, grey, exterior	Not Analyzed			
71915215PLM_30					
0049C	Caulking at window frame, grey, exterior	Not Analyzed			
71915215PLM_31					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAL. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (39)


Analyst

Approved Signatory



71915215

Version 1-15-2012

<b>Client:</b> <b>Contact:</b> <b>Address:</b> <b>Phone:</b> <b>Fax:</b> <b>Email:</b>  <b>Project:</b>  <b>Client Notes:</b>   <b>P.O. #:</b> <b>Date Submitted:</b>  <b>Analysis:</b> <b>TurnAroundTime:</b>	Pinchin Ltd. Stephen Holmquist 875 Main Street W., Unit 11 Hamilton, ON L8S 4R9 905-577-6206 905-577-6207 <a href="mailto:sholmquist@pinchin.com">sholmquist@pinchin.com</a> <a href="mailto:lcantar@pinchin.com">lcantar@pinchin.com</a> 243241.004,200 Acadia Drive, Hamilton, Ontario,Hamilton- Wentworth Catholic District School Board,St. Jean de Brebeuf    243241.004 June 6,2019  <b>PLM - Stop Positive except 0042A-G</b> 4days	<p align="center"><b>*Instructions:</b>          Use Column "B" for your contact info</p> <p align="center">To See an Example Click the          bottom Example Tab.</p> <p align="center">Enter samples between "&lt;&lt;" and "&gt;&gt;"</p> <p align="center"><b>Begin Samples with a "&lt;&lt;" above the first sample          and end with a "&gt;&gt;" below the last sample.          Only Enter your data on the first sheet "Sheet1"</b></p> <p align="center">Note: Data 1 and Data 2 are optional          fields that do not show up on the official          report, however they will be included</p> <p align="center">In the electronic data returned to you          to facilitate your reintegration of the report data.</p>	<p align="right"><b>Invoice to:</b>  <a href="mailto:ap@pinchin.com">ap@pinchin.com</a></p> <div align="center">  <p><b>Scientific          Analytical          Institute</b></p> <p><b>4604 Dundas Dr.          Greensboro, NC 27407          Phone: 336.292.3888          Fax: 336.292.3313          Email: lab@sailab.com</b></p> </div>
--	---	---	--

Sample Number	Data 1 (Lab use only)	Sample Description	Data 2 (Lab use only)
---------------	-----------------------	--------------------	-----------------------

<<			
0041A		Caulking on panels below window, grey, exterior	
0041B		Caulking on panels below window, grey, exterior	
0041C		Caulking on panels below window, grey, exterior	
0042A		Plaster ceiling, Location 1004	
0042B		Plaster ceiling, Location 1001	
0042C		Plaster ceiling, Location 1025	
0042D		Plaster ceiling, Location 1023	
0042E		Plaster ceiling, Location 2012	
0042F		Plaster ceiling, Location 2001	
0042G		Plaster ceiling, Location 2043	
0043A		Caulking around window, white, Location 1002	
0043B		Caulking around window, white, Location 1002	

**Accepted**    
**Rejected**    
 Behler 4/7   
 1030 P

71915215

- 0043C Caulking around window, white, Location 1002
  - 0044A Caulking on expansion joints, white, courtyard
  - 0044B Caulking on expansion joints, white, courtyard
  - 0044C Caulking on expansion joints, white, courtyard
  - 0045A Caulking within window frame, off-white, courtyard
  - 0045B Caulking within window frame, off-white, courtyard
  - 0045C Caulking within window frame, off-white, courtyard
  - 0046A Caulking around louvers, black/grey, courtyard
  - 0046B Caulking around louvers, black/grey, courtyard
  - 0046C Caulking around louvers, black/grey, courtyard
  - 0047A Puck mastic, brown, Location 1023
  - 0047B Puck mastic, brown, Location 1023
  - 0047C Puck mastic, brown, Location 1023
  - 0048A Caulking on window sill, grey, exterior of Location 2010
  - 0048B Caulking on window sill, grey, exterior of Location 2010
  - 0048C Caulking on window sill, grey, exterior of Location 2010
  - 0049A Caulking at window frame, grey, exterior
  - 0049B Caulking at window frame, grey, exterior
  - 0049C Caulking at window frame, grey, exterior
- >>



# Bulk Asbestos Analysis

By Polarized Light Microscopy  
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,  
App.E



**Customer:** Pinchin Ltd.  
6-875 Main St West  
Suite 200  
Hamilton, Ontario L8S 4P9

**Attn:** Emily Balfour  
Michael Maiorana

**Lab Order ID:** 71919573  
**Analysis ID:** 71919573\_PLM  
**Date Received:** 7/25/2019  
**Date Reported:** 7/30/2019  
**Date Amended:** 8/21/2019

**Project:** 230748,200 Acadia Drive, Hamilton, Ontario, Hamilton-Wentworth Catholic School Board, St. Jean de Brebeuf

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
S0050A	Texture coat on soffit, Hallway, Location 1041	2% Chrysotile		98% Other	White Non Fibrous Heterogeneous
71919573PLM_1					Crushed
S0050B	Texture coat on soffit, Hallway, Location 1041	Not Analyzed			
71919573PLM_2					
S0050C	Texture coat on soffit, Hallway, Location 1041	Not Analyzed			
71919573PLM_3					
S0051A	Mastic, Hallway, Location 2029	3% Chrysotile		97% Other	Black Non Fibrous Heterogeneous
71919573PLM_4					Dissolved
S0051A		Not Analyzed			
71919573PLM_5	duplicate sample number				
S0051B	Mastic, Hallway, Location 2027	Not Analyzed			
71919573PLM_6					
S0051C	Mastic, Hallway, Location 2026	Not Analyzed			
71919573PLM_7					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAL. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.


Bart Huber (7)

Analyst

Approved Signatory

71919573  
Revised

Version 1-15-2012

<b>Client:</b>	Pinchin Ltd.	<p><b>*Instructions:</b> Use Column "B" for your contact info</p> <p>To See an Example Click the bottom Example Tab.</p> <p>Enter samples between "&lt;&lt;" and "&gt;&gt;"</p> <p>Begin Samples with a "&lt;&lt;" above the first sample and end with a "&gt;&gt;" below the last sample. Only Enter your data on the first sheet "Sheet1"</p> <p>Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.</p>	<b>Invoice to:</b>
<b>Contact:</b>	Emily Balfour		ap@pinchin.com
<b>Address:</b>	6-875 Main Street West, Suite 200, Hamilton ON L8S 4P9		 <p>Scientific Analytical Institute</p>
<b>Phone:</b>	905-577-6206		
<b>Fax:</b>	905-577-6207		
<b>Email:</b>	ebalfour@pinchin.com mmaiorana@pinchin.com		
<b>Project:</b>	230748,200 Acadia Drive, Hamilton, Ontario,Hamilton-Wentworth Catholic School Board,St. Jean de Brebeuf		
<b>Client Notes:</b>			<p>4604 Dundas Dr. Greensboro, NC 27407 Phone: 336.292.3888 Fax: 336.292.3313 Email: lab@sailab.com</p>
<b>P.O. #:</b>			230748
<b>Date Submitted:</b>	July 24,2019		
<b>Analysis:</b>	PLM - Stop Positive		
<b>TurnAroundTime:</b>	4days		

Sample Number	Data 1 (Lab use only)	Sample Description	Data 2 (Lab use only)
---------------	-----------------------	--------------------	-----------------------

<<			
S0050A		Texture coat on soffit, Hallway, Location 1041	
S0050A		Texture coat on soffit, Hallway, Location 1041	
S0050A		Texture coat on soffit, Hallway, Location 1041	
S0051A		Mastic, Hallway, Location 2029	
S0051B		Mastic, Hallway, Location 2027	
S0051C		Mastic, Hallway, Location 2026	
>>			

Accepted

Rejected

J. [Signature] 8.21  
10:30A

**APPENDIX III**  
**Methodology**

## 1.0 GENERAL

An inspection was conducted to identify the asbestos-containing materials (ACM) incorporated in the structure and its finishes as defined by the scope of work.

Information regarding the location and condition of ACM encountered and visually estimated quantities were recorded. The locations of any samples collected were recorded on small-scale plans. As-built drawings and previous reports were referenced where provided.

Sample collection (where performed) was conducted in accordance with our Standard Operating Procedures.

The inspection for asbestos included friable and non-friable asbestos-containing materials (ACM). A friable material is a material that when dry can be crumbled, pulverized or powdered by hand pressure.

Where samples were collected, a separate set of samples was collected of each type of homogenous material suspected to contain asbestos. A homogenous material is defined by the US EPA as material that is uniform in texture and appearance, was installed at one time, and is unlikely to consist of more than one type or formulation of material. The homogeneous materials were determined by visual examination and available information on the phases of construction and prior renovations.

Where samples were collected, samples were collected at a rate that is in compliance with the requirements of local regulations and guidelines. The sampling strategy was also based on known ban dates and phase out dates of the use of asbestos; sampling of certain building materials is not conducted after specific construction dates. In addition, to be conservative, several years past these dates are added to account for some uncertainty in the exact start / finish date of construction and associated usage of ACM. In some cases, manufactured products such as asbestos cement pipe were visually identified without sample confirmation.

Where samples were collected, the asbestos analysis was completed using a stop-positive approach. Only one result meeting the regulated criteria was required to determine that a material is asbestos-containing, but all samples must be analyzed to conclusively determine that a material is non-asbestos. The laboratory stopped analyzing samples from a homogeneous material once a result equal to or greater than the regulated criteria is detected in any of the samples of that material. All samples of a homogeneous material were analyzed if no asbestos is detected. In some cases, all samples were analyzed in the sample set regardless of result.

Where samples were collected, the analysis was performed in accordance with Test Method EPA/600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials, July 1993.

Where samples were collected, analytical results were compared to the following criteria.



<b>Jurisdiction*</b>	<b>Friable</b>	<b>Non-Friable</b>
Ontario	0.5%	0.5%

Where building materials are described in the report as “non-asbestos” or “does not contain asbestos”, this means that either no asbestos was detected by the analytical method utilized in any of the multiple samples or, if detected, it is below the lower limit of an asbestos-containing material in the applicable regulation. Additionally, these terms are used for materials which historically are known to not include asbestos in their manufacturing.

Asbestos materials were evaluated in order to make recommendations regarding remedial work. The priority for remedial action was based on several factors:

- Friability (friable or non-friable);
- Condition (good, fair, poor, debris);
- Accessibility (ranking from accessible to all building users to inaccessible);
- Visibility (whether the material is obscured by other building components).
- Efficiency of the work (for example, if damaged ACM is being removed in an area, it may be most practical to remove all ACM in the area even if it is in good condition).

For a complete description of the Evaluation Criteria and Basis of Recommendations, refer to Annex A.

## **METHODOLOGY ANNEX A EVALUATION CRITERIA**



## EVALUATION CRITERIA AND BASIS OF RECOMMENDATIONS

The detailed asbestos assessment provides information regarding the location, condition, accessibility and friability of the asbestos-containing materials (ACM). In order to make recommendations for compliance with current regulations, Pinchin developed the following criteria.

### EVALUATION OF CONDITION

#### Friable Sprayed or Trowelled Fireproofing, Thermal Insulation and Texture Finishes (Surfacing Materials)

To evaluate the condition of ACM sprayed or trowelled on fireproofing, sprayed or trowelled thermal insulation (non-mechanical), or texture, decorative or acoustic finishes, the following criteria are applied:

<b>Good</b>	Surface of material shows no significant signs of damage, deterioration or delamination. Good condition includes unencapsulated or unpainted fireproofing or texture finishes, where no or limited delamination or damage is observed, or encapsulated fireproofing or texture finishes where the encapsulant or paint has been applied after the damage or fallout occurred.
<b>Poor</b>	A sprayed material that shows signs of significant damage or is significantly delaminating or deteriorating. This may be limited to surface delamination or some portion of the substrate may be exposed.

In Locations where damage exists in isolated areas, both good and poor condition may be applicable. The extent of each condition will be recorded. Fair condition is not utilized in the evaluation of ACM sprayed or trowelled fireproofing, sprayed or trowelled thermal insulation (non-mechanical), or texture, decorative or acoustic finishes.

The evaluation of the above products above ceilings may be limited by the number of observations and by building components such as ducts or full height walls that obstruct the above ceiling observations.

#### Friable Mechanical or Thermal System Insulation (TSI)

To evaluate the condition of mechanical insulation on vessels, boilers, breeching, ducts, pipes, fan units, equipment etc. the following criteria are applied:

<b>Good</b>	Insulation is completely covered in jacketing and exhibits no evidence of damage or deterioration. No insulation is exposed. Includes conditions where the jacketing has minor damage (i.e. scuffs or stains), but the jacketing is not penetrated.
<b>Fair</b>	Minor penetrating damage to jacketed insulation (cuts, tears, nicks, deterioration or delamination) or undamaged insulation that has never been jacketed. Insulation is exposed but not showing surface disintegration. The extent of missing insulation ranges from minor to none. Damage can be repaired.

---

<b>Poor</b>	Original insulation jacket is missing, damaged, deteriorated or delaminated. Insulation is exposed and significant areas have been dislodged. Damage cannot be readily repaired. Includes components where insulation may have been removed incompletely.
-------------	---

---

The evaluation of mechanical insulation may be limited by the number of observations made and building components such as ducts or full height walls that obstruct observations. It is often not possible to observe each foot of mechanical insulation from all angles.

**Potentially Friable Materials and Miscellaneous Friable Materials**

Potentially friable ACM are products that are basically non-friable while in place but have the potential to generate friable dust upon removal or if significantly disturbed without appropriate procedures. These products may become friable if damaged. Potentially friable materials include materials such as acoustic ceiling tiles and plaster. To evaluate the condition of potentially friable materials, the following criteria are applied:

---

<b>Good</b>	No significant damage or deterioration. Still serving its intended use as a building material or finish.
<b>Fair</b>	Showing signs of some cracking or breakage, but is not deteriorating (e.g. cracked plaster, broken but in place ceiling tile, missing tile or section of plaster etc.). The condition is such that it is still serving its intended use as a building material or finish but may require repair for mainly cosmetic purposes.
<b>Poor</b>	Significant deterioration or breaking apart of the material. Material has deteriorated to the point it is not serving its intended use as building material or finish. Material has deteriorated to a point it has become friable. Normally potentially friable ACM in Poor condition is not repairable and requires at least localized removal and replacement.

---

**Non-Friable Materials**

Non-friable ACM cover a wide range of products with a wide variation in their tendency to release dust or asbestos fibres to the air. Many of these materials, (particularly where the matrix is an unweathered bitumen, asphalt or tar material) do not release fibres except in very unusual circumstances or during significant disturbance (e.g. use of abrasive power tools). Others with a cementitious matrix (asbestos-cement products) can more readily release dust due to abrasion, demolition, weathering, etc. The potential for asbestos release from non-friable ACM is always lower than from friable ACM. To evaluate the condition of non-friable Materials, the following criteria are applied:

---

<b>Good</b>	No significant damage or deterioration. Still serving its intended use as a building material or finish.
-------------	--

---

---

<b>Fair</b>	Showing signs of some cracking or breakage but is not deteriorating (e.g. cracked vinyl floor tile, missing piece of tile or transite, etc.). The condition is such that it is still serving its intended use as a building material or finish but may require repair for mainly cosmetic purposes.
<b>Poor</b>	Significant deterioration or breaking apart of the material to the point at which it cannot be repaired, and it will require at least local removal. Material has deteriorated to the point it is not serving its intended use as building material or finish. Material may have deteriorated to a point where traffic or disturbance may cause it to become friable.

---

### Evaluation of ACM Debris

The identification of the exact location or presence of debris on the top of ceiling tiles is limited by the number of observations made and the presence of building components such as ducts or full height walls that obstruct observations.

The presence of fallen or dislodged ACM is noted separately from the ACM source and is referred to as Debris. Debris may be friable if from a friable ACM source or a badly deteriorated non-friable ACM source. Debris may also be non-friable (such as fallen pieces of transite sheet or mastic fittings, or broken, dislodged floor tiles).

---

<b>Debris</b>	Debris may be friable or non-friable but is always identified as debris.
---------------	--

---

### Evaluation of Presumed Asbestos-Containing Material (PACM)

Presumed asbestos-containing materials (PACM), are building materials that may contain asbestos but were not sampled or analyzed due to inaccessibility or the need to perform destructive testing to obtain a reasonable sample set. Evaluation of these materials is based on the assumption that these PACM are asbestos-containing.

A list of PACM is provided in the report and they are generally not included in the detailed room by room reports. Typically, they are excluded because they are inaccessible or present in very small quantities. If PACM are evaluated, Pinchin uses the criteria that correspond with the type (and friability) of the material listed above.

## EVALUATION OF ACCESSIBILITY

The accessibility of building materials known or suspected of being ACM is rated according to the following criteria:

<b>Access (A)</b>	Common areas of the building within reach of all building users (approximately 8' - 9' from floor or standard ceiling height). Includes other areas where occupant activities may result in disturbance of material that is not normally within reach from floor level, but may be disturbed by common activities (e.g. gymnasiums, workshops, warehouses)
<b>Access (B)</b>	Areas of the building accessed primarily by Maintenance/Caretaking/Janitorial Staff and within reach without use of a ladder. Includes areas within reach in Boiler Rooms, Electrical Rooms, Janitors Closets, Elevator Rooms, Mechanical Rooms, etc. Includes materials within reach from fixed ladders or catwalks, mezzanines, and accessible pipe chases.
<b>Access (C) and Visible</b>	Areas of the building above 8' - 9' where use of a ladder or scaffold is required to reach the ACM. Only includes ACM that are visible to view without the removal or opening of other building components such as ceiling tiles or service access panels. Visible column on HMIS sheets will say YES.
<b>Access (C) and not Visible</b>	Areas of the building above 8' - 9' where use of a ladder or scaffold is required to reach the ACM. Includes ACM that are not visible to view and require the removal of a building component to see, such as ceilings tiles or access panels to view and access. Includes rarely entered crawl spaces, attic spaces, etc. Observations will be limited to the extent visible from the access points. Visible column on HMIS sheets will say NO.
<b>Access (D)</b>	Areas of the building behind inaccessible solid ceiling systems, walls or equipment etc. where demolition of the ceiling, wall or equipment etc. is required to reach the ACM. Material inaccessible due to height or location or is only accessed under unusual situations. Evaluation of condition and extent of ACM is limited or impossible, depending on the surveyor's ability to visually examine materials in Access D.

## ACTION MATRIX AND DEFINITIONS

Pinchin's evaluation of the viability of a specific asbestos control option is based on the consideration of the friability, condition, accessibility and visibility of a material. The logic used is that damaged ACM located in an area frequently accessed by all building occupants is of a higher priority than damaged ACM located in an infrequently accessed service area. The action matrix considers the potential for fibre release (primarily from friable ACM) and the possible concerns from regulatory bodies and many building occupants to all damaged ACM (including non-friable).

In any building with asbestos, many current regulations require an Asbestos Management Program be implemented. Depending on the condition and the accessibility, more active measures such as repair or removal may be recommended. The following matrix provides guidance for recommended Actions in the absence of renovation or demolition. In the event of construction or maintenance activity which will disturb ACM more aggressive control or removal will be required.

### Action Matrix

The following tables outline the action decisions based on the relationship of assessed factors. Table I applies to friable ACM. Table II applies to non-friable ACM.

**Table I Decision Matrix for Friable ACM**

Access	Condition			Debris
	Good	Fair	Poor	
(A)	Action 5 <sup>1</sup>	Action 5 <sup>2</sup>	Action 3	Action 1
(B)	Action 7	Action 6 <sup>3</sup>	Action 3	Action 1
(C) Visible	Action 7	Action 6	Action 3	Action 2
(C) Not Visible	Action 7	Action 7	Action 4	Action 2
(D)	Action 7	Action 7	Action 7	Action 7

**Table II Decision Matrix for Potentially Friable and Non-Friable ACM**

Access	Condition			Debris
	Good	Fair	Poor	
(A)	Action 7	Action 7 <sup>4</sup>	Action 3	Action 1
(B)	Action 7	Action 7	Action 3	Action 1
(C) Visible	Action 7	Action 7	Action 4	Action 2
(C) Not Visible	Action 7	Action 7	Action 4	Action 2
(D)	Action 7	Action 7	Action 7	Action 7

### Action Definitions

The following are the definitions in the Action Matrix Table presented above:

#### Action Definitions

<b>Action 1</b>	Clean-Up of ACM Debris Restrict access that is likely to cause a disturbance of the ACM Debris and clean up ACM Debris. Utilize appropriate asbestos precautions.
-----------------	--

<sup>1</sup> If friable ACM in access (A)/Good condition is not proactively removed Action 7 (Manage) is recommended.

<sup>2</sup> If friable ACM in access (A)/Fair condition is not proactively removed repair is recommended.

<sup>3</sup> If friable ACM in access (B)/Fair condition is likely to be disturbed after repair proactive removal is recommended.

<sup>4</sup> Action 7 is recommended for all non-friable ACM in Fair condition however some clients may wish to repair or take some action primarily for cosmetic reasons



---

**Action Definitions**

---

<b>Action 2</b>	Precautions for Access Which may Disturb ACM Debris Use appropriate means to isolate the debris or to limit entry to the area which may disturb the material. At locations where ACM Debris can remain in place in lieu of removal or clean-up (e.g. Debris on top of ceiling tiles or behind lockable door), Utilize appropriate asbestos precautions to enter the area if this will disturb debris. The precautions will be required until the ACM Debris has been cleaned up.
<b>Action 3</b>	ACM Removal Remove ACM. Utilize asbestos procedures appropriate to the scope of the removal work. Until it is removed, restrict access to the material so it is not disturbed.
<b>Action 4</b>	Precautions for Work Which may Disturb ACM in Poor Condition. Utilize appropriate asbestos precautions if ACM may be disturbed by work on or near ACM. This does not require restricting access to the area, only control of work which may contact or disturb the ACM. Removal is the only viable option if work will disturb ACM.
<b>Action 5</b>	Proactive ACM Removal Remove friable ACM where the presence of friable asbestos in Good condition is not desirable. If friable ACM in Fair condition is not removed, then Repair friable ACM.
<b>Action 6</b>	ACM Repair Repair friable ACM in Fair condition which is not likely to be damaged again or disturbed by normal use of the area or room. Pinchin recommends proactive removal if friable ACM is likely to be damaged or disturbed during normal use of the area or room
<b>Action 7</b>	Asbestos Management Program with Routine Surveillance Implement an Asbestos Management Program, including routine surveillance of ACM. Reassess materials regularly (typically once per year).

---

**APPENDIX IV**  
**Location List**

**Client:** Hamilton-Wentworth Catholic District Sch  
**Building Name:** St Jean de Brebeuf  
**Survey Date:** 2018-08-03  
**Building Phases:** A: 1973 , B: 2018

**Site:** 200 Acadia Drive, Hamilton, ON  
**Last Re-Assessment:** 2023-08-01

Location No.	Name or Description	Area ft <sup>2</sup>	Floor No.	Bldg. Phase	Notes
0	Presumed Asbestos-Containing Materials	0	0	A	Where present, these materials are assumed to contain asbestos until otherwise proven by sampling and analysis.
1	Exterior	0	ALL	A	
1000	Classroom 119, room no. 119	0	1	A	
1001	Classroom 117, room no. 117	0	1	A	
1002	Classroom 115A, room no. 115A	0	1	A	
1003	Co-op Office, room no. 115B	0	1	A	
1004	Office, room no. 113A	0	1	A	
1005	Classroom 113, room no. 113	0	1	A	
1006	Stairwell	0	1	A	
1007	Amalgamated into Loc 1010	0	1	A	
1008	Amalgamated into Loc 1010	0	1	A	
1009	Amalgamated into Loc 1010	0	1	A	
1010	Student Services, room no. 109	0	1	A	
1011	Hallway	0	1	A	
1012	Hallway	0	1	A	
1013	Hallway	0	1	A	
1014	Stairwell	0	1	A	
1015	Classroom 113, room no. 113	0	1	A	
1016	Classroom 112, room no. 112	0	1	A	
1017	Classroom 114, room no. 114	0	1	A	
1018	Girls Washroom, room no. 116	0	1	A	
1019	Boys Washroom, room no. 118	0	1	A	
1020	Classroom 120, room no. 120	0	1	A	
1021	Classroom 122, room no. 122	0	1	A	
1022	Classroom 124, room no. 124	0	1	A	
1023	Classroom 126, room no. 126	0	1	A	
1024	Classroom 121, room no. 121	0	1	A	
1025	Classroom 121A, room no. 121A	0	1	A	
1026	Classroom 123, room no. 123	0	1	A	
1027	Resource/Spec. Ed, room no. 125/127	0	1	A	
1028	Spec. Education Washroom, room no. 127	0	1	A	
1029	Boys Washroom	0	1	A	
1030	Custodial Closet	0	1	A	
1031	Girls Washroom, room no. 132	0	1	A	
1032	Mens Staff Washroom	0	1	A	
1033	Staff Lounge	0	1	A	
1034	Photocopy Supply Room	0	1	A	
1035	Womens Staff Washroom	0	1	A	
1036	Photocopy Room	0	1	A	
1037	Amalgamated into Loc 1010	0	1	A	
1038	Amalgamated into Loc 1010	0	1	A	
1039	Amalgamated into Loc 1010	0	1	A	
1040	Stairwell	0	1	A	
1041	Hallway	0	1	A	
1042	Library	0	1	A	
1043	Hallway	0	1	A	
1044	Hallway	0	1	A	
1045	Cafeteria	0	1	A	
1046	Kitchen	0	1	A	
1047	Math Department	0	1	A	
1048	Stairwell	0	1	A	
1049	Classroom 131, room no. 131	0	1	A	
1050	Hallway	0	1	A	
1051	Hallway	0	1	A	
1052	Hallway	0	1	A	
1053	Woodworking Washroom	0	1	A	
1054	Custodial Closet	0	1	A	



Location No.	Name or Description	Area ft <sup>2</sup>	Floor No.	Bldg. Phase	Notes
1055	Chapel	0	1	A	
1056	Chapel Office	0	1	A	
1057	Classroom T-152, room no. T-152	0	1	A	
1058	Classroom T-154, room no. T-154	0	1	A	
1059	Boiler Room, room no. T-156	0	1	A	
1060	Boiler Room Lockers	0	1	A	
1061	Boiler Room Tool Room	0	1	A	
1062	Boiler Room Washroom	0	1	A	
1063	Woodworking, room no. T-160	0	1	A	
1064	Transportation Services	0	1	A	
1065	Art T-149B, room no. T-149B	0	1	A	
1066	Art T-149A, room no. T-149A	0	1	A	
1067	Tech Services T-157B, room no. T-157B	0	1	A	
1068	Tech Services T-157A, room no. T-157A	0	1	A	
1069	Manufacturing, room no. T-155	0	1	A	
1070	Studio, room no. T-153S	0	1	A	
1071	Computer Lab, room no. T-153G	0	1	A	
1072	Computer Engineering, room no. T-151	0	1	A	
1073	Hallway	0	1	A	
1074	Hallway	0	1	A	
1075	Vestibule	0	1	A	
1076	Front Foyer	0	1	A	
1077	Stairs	0	1	A	
1078	Auditorium	0	1	A	
1079	Stage	0	1	A	
1080	Auditorium Hallway	0	1	A	
1081	Stage Hallway	0	1	A	
1082	Auditorium Washroom	0	1	A	
1083	Kilters Room	0	1	A	
1084	Co-Inst. Office	0	1	A	
1085	Boys Washroom	0	1	A	
1086	Girls Washroom	0	1	A	
1087	Mens Locker Room	0	1	A	
1088	Phys Ed. Department	0	1	A	
1089	Fitness Centre	0	1	A	
1090	Music Room	0	1	A	
1091	Gym Storage	0	1	A	
1092	Gym Storage	0	1	A	
1093	Gym Storage	0	1	A	
1094	Gym Storage Corridor	0	1	A	
1095	Gym Storage	0	1	A	
1096	Gym Storage	0	1	A	
1097	Gym Storage	0	1	A	
1098	Gym Storage	0	1	A	
1099	Gym Storage	0	1	A	
1100	Gym	0	1	A	
1101	Hallway to Gym	0	1	A	
1102	Hallway Foyer	0	1	A	
1103	Staff Locker Room	0	1	A	
1104	Hallway to Gym	0	1	A	
1105	Womens Locker Room	0	1	A	
1106	Custodial Closet	0	1	A	
1107	Womens Locker Room	0	1	A	
1108	Custodial Closet, room no. 116B	0	1	A	
1109	Custodial Closet	0	1	A	
1110	Storage	0	1	A	
1111	Boiler Room Lunchroom	0	1	A	
1112	Gym Storage	0	1	A	
1113	Hallway to Gym	0	1	A	
1114	Storage	0	1	A	

Location No.	Name or Description	Area ft <sup>2</sup>	Floor No.	Bldg. Phase	Notes
1115	Storage by Stage	0	1	A	
1116	2018 Addition	0	1	B	
2000	French Classroom 219, room no. 219	0	2	A	
2001	French Classroom 217, room no. 217	0	2	A	
2002	English Office 215, room no. 215	0	2	A	
2003	Storage	0	2	A	
2004	Science Classroom 213, room no. 213	0	2	A	
2005	Stairwell	0	2	A	
2006	English Classroom 211, room no. 211	0	2	A	
2007	Science Classroom 209, room no. 209	0	2	A	
2008	Storage, room no. 208	0	2	A	
2009	Science Classroom 207, room no. 207	0	2	A	
2010	Science Classroom 205, room no. 205	0	2	A	
2011	Science Classroom 203, room no. 203	0	2	A	
2012	Classroom 201, room no. 201	0	2	A	
2013	Stairwell	0	2	A	
2014	Classroom 240, room no. 240	0	2	A	
2015	Classroom 237, room no. 237	0	2	A	
2016	Classroom 235, room no. 235	0	2	A	
2017	Classroom 233, room no. 233	0	2	A	
2018	Stairwell	0	2	A	
2019	History Classroom 231, room no. 231	0	2	A	
2020	Math Classroom 229, room no. 229	0	2	A	
2021	Math Classroom 227, room no. 227	0	2	A	
2022	Math Classroom 225, room no. 225	0	2	A	
2023	Family Studies 223, room no. 223	0	2	A	
2024	Family Studies 221, room no. 221	0	2	A	
2025	Stairwell	0	2	A	
2026	Hallway	0	2	A	
2027	Hallway	0	2	A	
2028	Hallway	0	2	A	
2029	Hallway	0	2	A	
2030	English Classroom 210, room no. 210	0	2	A	
2031	English Classroom 212, room no. 212	0	2	A	
2032	English Classroom 214, room no. 214	0	2	A	
2033	Girls Washroom	0	2	A	
2034	Boys Washroom	0	2	A	
2035	French Classroom 220, room no. 220	0	2	A	
2036	French Classroom 222, room no. 222	0	2	A	
2037	Math Classroom 224, room no. 224	0	2	A	
2038	Math Classroom 226, room no. 226	0	2	A	
2039	Boys Washroom	0	2	A	
2040	Custodial Closet	0	2	A	
2041	Girls Washroom	0	2	A	
2042	Storage	0	2	A	
2043	Science Classroom 234, room no. 234	0	2	A	

Location No.	Name or Description	Area ft <sup>2</sup>	Floor No.	Bldg. Phase	Notes
2044	History Classroom 236, room no. 236	0	2	A	
2045	Storage	0	2	A	
2046	Foyer	0	2	A	
2047	Storage	0	2	A	
2048	Stairwell	0	2	A	
2049	Dance Studio 200A, room no. 200A	0	2	A	
2050	Health Sciences 200B, room no. 200B	0	2	A	
2051	Stairwell	0	2	A	
2052	Fan Room	0	2	A	
2053	Custodial Closet	0	2	A	
2054	Science Storage	0	2	A	
2055	Catwalk	0	2	A	

**APPENDIX V**  
**Summary Report / Sample Log**

Client: Hamilton-Wentworth Catholic District Sch

Site: 200 Acadia Drive, Hamilton, ON

Building Name: St Jean de Brebeuf

Survey Date: 2018-08-03

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
Asbestos	S0001 A	Structure   Beam, Deck   Fireproofing (cementitious)   Amec-1 (12-feb-09)	2052	A	0	0	0	0	None Detected	No	
Asbestos	S0002 A	Duct     Parging Cement   Amec-2 (12-feb-09)	2052	A	0	0	0	0	None Detected	No	
Asbestos	S0004 A	Wall     Fibreglass   Amec-4 (12-feb-09)	2052	A	0	0	0	0	None Detected	No	
Asbestos	S0005 A	Piping     Parging Cement   Amec-5 (12-feb-09) - Canvas Wrapped Parging With Tar Paper And Cellulose (sweatwrap & Parging)	2051	A	15	0	0	0	Chrysotile	Yes	F
Asbestos	S0006 ABCDEF	Ceiling, Wall, Ceiling, Wall   Bulkhead   Drywall And Joint Compound   Amec-6 (12-feb-09)	1002,1003,1004,1005,1010,1034,1036,1042,1045,1050,1051,1052,1053,1055,1058,1059,1063,1064,1067,1068,1070,1071,1072,1082,1084,1094,1105,2004,2017,2049,2050,2051,2055	A	0	0	0	100	None Detected	No	
Asbestos	S0007 ABCDEG	Ceiling, Structure, Wall     Plaster   Amec-7 (12-feb-09)	1000,1003,1006,1014,1015,1016,1017,1018,1019,1020,1021,1022,1027,1029,1030,1031,1033,1034,1035,1036,1040,1045,1046,1048,1049,1054,1055,1057,1058,1060,1061,1062,1063,1064,1075,1077,1080,1081,1083,1085,1086,1087,1090,1091,1092,1093,1094,1095,1097,1098,1099,1103,1106,1107,1108,1109,1110,1111,1112,1114,1115,2000,2002,2003,2004,2005,2006,2007,2008,2009,2010,2011,2013,2014,2015,2016,2017,2018,2019,2020,2021,2022,2023,2024,2025,2030,2031,2032,2033,2034,2035,2036,2037,2038,2039,2040,2041,2042,2044,2045,2046,2047,2048,2051,2053,2054	A	0	0	0	100	None Detected	No	
Asbestos	S0008 AD	Structure     Fireproofing (cementitious)   Amec-8 (12-feb-09)	1027,1028,1079,1087,1104,1105,1107,1112,1113	A	0	0	0	0	None Detected	No	
Asbestos	S0009 ABC	Ceiling   Acoustic Tile   Ceiling Tiles (lay-in)   Amec-9 (12-feb-09)	1002,1003,1027,1028,1073,1074,1087,1088,1100,1101,1103,1104,1105,1107,1112,1113,2014,2015,2016,2017,2049,2050,2055	A	0	0	0	0	None Detected	No	
Asbestos	S0010 ABC	Ceiling   Acoustic Tile   Ceiling Tiles (lay-in)   Amec-10 (12-feb-09)	1005,1043,1044,1050,1051,1052,1073,1074,1087,1090,2026,2027,2028,2029	A	0	0	0	0	None Detected	No	
Asbestos	S0011 ABC	Ceiling   Acoustic Tile   Ceiling Tiles (lay-in)   Amec-11 (12-feb-09)	1004,1005,1011,1013,1033,1041,1043,1044,1050,1051,1052,1070,1071,1072,1073,1074,1087,2026,2027,2028,2029	A	0	0	0	0	None Detected	No	
Asbestos	S0012 ACEF	Structure     Fireproofing (cementitious)   Amec-12 (12-feb-09)	1011,1012,1013,1041,1043,1044,1050,1051,1052,1073,1074,1075,1076,1101,1102,2026,2027,2028,2029	A	0	0	0	0	None Detected	No	
Asbestos	S0013 A	Ceiling   Acoustic Tile   Ceiling Tiles (lay-in)   Amec-13 (12-feb-09)	1032,1050,1051,1052,1073,1074	A	0	0	0	0	None Detected	No	
Asbestos	S0015 AC	Piping, Other, Piping   Light Fixture   Tar Paper   Amec-15 (12-feb-09)	1002,1011,1012,1013,1024,1073,1081,1108,2040	A	0	0	0	100	None Detected	No	

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
Asbestos	S0016 A	Other   Light Fixture   Foil Face   Amec-16 (12-feb-09)	1082,1110,1115,2045	A	0	0	5	100	Chrysotile	Yes	NF
Asbestos	S0018 A	Ceiling   Acoustic Tile   Ceiling Tiles (lay-in)   Amec-18 (12-feb-09)	1011,1012,1013,1075,1076,1102	A	0	0	0	0	None Detected	No	
Asbestos	S0019	Ceiling   Acoustic Tile   Ceiling Tiles (lay-in)   Amec-19 (12-feb-09)	1042	A	0	0	0	0	None Detected	No	
Asbestos	S0022 A	Wall     Plaster   Amec-22 (12-feb-09)	1080,1081	A	0	0	0	0	None Detected	No	
Asbestos	S0024 A	Ceiling   Acoustic Tile   Ceiling Tiles (lay-in)   Amec-24 (12-feb-09)	1055,1056	A	0	0	0	0	None Detected	No	
Asbestos	S0031	Ceiling     Texture Coat   Amec-31 (12-feb-09)	1055	A	0	1200	0	0	Chrysotile	Yes	F
Asbestos	V0033	Piping     Parging Cement   "advanced Environmental Corporation"	1002,1003,1004,1025,1036,1046,1061,1063,1064,1068,1069,1081,2046	A	0	0	177	0	Chrysotile	Yes	F
Asbestos	V0034	Ceiling, Wall   Acoustic Tile   Ceiling Tiles (glue-on)   Sample Id 10074-sjb-201 (sampled 25-may-10) - 1' X 1' Glued-on Ceiling Tile, Large Pinhole Pattern	1000,1001,1015,1016,1017,1020,1021,1022,1023,1047,2000,2001,2006,2012,2019,2020,2021,2030,2031,2032,2035,2036,2037,2038,2044	A	0	700	0	100	None Detected	No	
Asbestos	V0035	Ceiling   Acoustic Tile   Ceiling Tiles (lay-in)   Sample Id 10074-sjb-202 (sampled 25-may-10)	1045	A	0	0	0	0	None Detected	No	
Asbestos	S0037	Floor     Vinyl Floor Tile (no Mastic)   Sample Id 2017-s01 (sampled 15-aug-17). Layer 1 Vft, Layer 2 Mastic	1065,1066,1067,1068,1069,1070,1071,1088,1091,1095,1096,1097,1099,2050	A	0	0	0	100	None Detected	No	
Asbestos	S0038	Floor     Vinyl Floor Tile (no Mastic)   Sample Id 2017-s02 (sampled 15-aug-17). Layer 1 Vft, Layer 2 Mastic	2000,2001,2002,2003,2006,2012,2019,2020,2021,2022,2023,2024,2031,2032,2035,2036,2037,2038	A	0	25950	0	100	Chrysotile	Yes	NF
Asbestos	S0039	Piping     Aircell	1064	A	220	0	0	0	Chrysotile	Yes	F
Asbestos	S0040	Ceiling     Ceiling Tiles (lay-in)   24" X 48" Random Width-wise Fissures	1070	A	0	0	0	100	None Detected	No	
Asbestos	S0041 ABC	Other   Window   Caulking	1	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0042 ABCDEFG	Ceiling     Plaster	1001,1004,1023,1025,2001,2012,2043	A	0	0	0	0	None Detected	No	
Asbestos	S0043 ABC	Other   Window   Caulking   White	1002	A	0	0	0	0	None Detected	No	
Asbestos	S0044 ABC	Other   Expansion Joint   Caulking   White, Courtyard	1	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0045 ABC	Other   Window   Caulking   Off-white, Courtyard	1	A	0	0	0	100	None Detected	No	
Asbestos	S0046 ABC	Other     Caulking   Black/grey, Around Louvers	1	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0047 ABC	Ceiling     Mastic   Puck, Brown	1023	A	0	0	0	100	None Detected	No	
Asbestos	S0048 ABC	Other   Window   Caulking   Grey, Window Sill	2010	A	0	0	0	0	Chrysotile	Yes	NF
Asbestos	S0049 ABC	Other   Window   Caulking   Grey, Window Frame	1	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0050 ABC	Ceiling   Soffit   Texture Coat	1041	A	0	0	0	100	Chrysotile	Yes	F

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
Asbestos	S0051 ABC	Floor     Mastic	2026,2027,2028,2029	A	0	3000	0	100	Chrysotile	Yes	NF
Asbestos	V9500	Duct     Fibreglass W/parging	1100	A	0	0	0	100	Presumed Asbestos	Yes	F
Asbestos	V9500	Floor     Mastic   Under New Non-asbestos Floor Tiles	1000,1001,1002,1005,1010,1015,1016,1017,1020,1021,1022,1023,1024,1025,1026,1027,1033,1034,1035,1036,1041,1049,1054,1055,1056,1057,1058,1072,1077,1087,1088,1089,1103,1105,1107,2004,2007,2008,2009,2010,2011,2015,2016,2017,2030,2043,2044,2045,2047,2050,2054	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Floor     Vinyl Floor Tile (no Mastic)   12x12 Green Dense Fleck, 12x12 Beige W Brown Streak, 12x12 Blue Dense Fleck, 12x12 Evergreen Dense Fleck, 12x12 Green Dense Fleck, 12x12 Grey Dense Fleck, 12x12 Light Blue Dense Fleck, 12x12 Light Blue Dense Fleck (under Counters), 12x12 Light Green Dense Fleck, 12x12 Lime Green Dense Fleck, 12x12 Red Dense Fleck, 12x12 Beige Fleck, 9x9 Beige W Brown Streak, 9x9 Brown W White Streak, 9x9 Orange With Brown Streak (under Counters), 9x9 White W Multi-colour Streak	1000,1001,1002,1005,1015,1016,1017,1020,1021,1022,1023,1024,1025,1026,1027,1035,1041,1049,1054,1057,1072,1077,1087,1088,1095,1096,1097,1103,1105,1107,2004,2007,2008,2009,2010,2011,2015,2016,2017,2030,2043,2044,2045,2047,2050,2054	A	0	800	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Floor     Vinyl Floor Tile And Mastic   12x12 Beige And Browns Flecks, 12x12 Beige With Brown Streaks, 12x12 Green Flecks, 9x9 Beige	1042,1063,1077,1100,1110,1112	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Floor     Vinyl Sheet Flooring   Faux Wood Pattern	2049	A	0	0	0	100	Presumed Asbestos	Yes	PF
Asbestos	V9500	Other   Countertop, Sink   Bakelite	2003,2007,2009,2010,2011,2054	A	0	0	0	89	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other   Door, Fumehood   Cement Product	2004,2009,2054	A	0	280	0	0	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other   Electric Light Fixture   Foil Face	1053,1080	A	0	0	3	0	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other   Sink   Mastic, Gold	1066,1071,2014	A	0	0	3	0	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other     N/a   Roofing Felts And Tar, Mastics, Floor Levelling Compound, Ceramic Tile Setting Compound, Electrical Components, Mechanical Packing, Ropes And Gaskets, Vermiculite, Adhesives And Duct Mastics, Caulking And Putties, Fibre-reinforced Paints And Coatings, Paper Products, Soffit And Fascia Boards, Fire Resistant Doors, Stucco, Plaster Or Other Cementitious Parge Coatings, Vibration Dampers On Hvac Equipment,	0	A	0	0	0	100	Presumed Asbestos	Yes	NF

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
		Terrazzo, Ropes And Gaskets In Cast-iron Bell And Spigot Joints, Sealants On Pipe Threads									
Asbestos	V9500	Other   Fire Door   Thermal Insulation	1059	A	0	0	1	0	Presumed Asbestos	Yes	F
Asbestos	V9500	Piping   Rain Water Leader   Cement Product	1011	A	40	0	0	0	Presumed Asbestos	Yes	NF
Asbestos	V0000	Ceiling     Ceiling Tiles (lay-in)   2016	1067	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling   Acoustic Tile   Ceiling Tiles (lay-in)   2x2 Ph Flecks (2016)	1078	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling   Acoustic Tile   Ceiling Tiles (lay-in)   2x4 2016	1010	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling     Ceiling Tiles (lay-in)   2x4 2018	1084	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling   Acoustic Tile   Ceiling Tiles (lay-in)   2x4 Small Flecks And Pinholes (2012)	1012	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling   Acoustic Tile   Ceiling Tiles (lay-in)   2x4 Pinhole And Texture (2014)	1041	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling     Ceiling Tiles (lay-in)   Horizontal	1063	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling     Concrete (precast)	1063,1065,1066,1068,1070,1072	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling     Drywall And Joint Compound   (2018)	1075,1076	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling     Drywall And Joint Compound   2018	1011	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling   Deck   Steel	2052	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Duct     Canvas	2052	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Carpet	1042,1055,1056	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Ceramic Tiles	1033,1048,1061,1076,1079,1083,1084,1087,1103 1105,1107,1110,1111,1115,2042,2046	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Ceramic Tiles   Multi-colour	1003,1004,1051,1052,2014	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Ceramic Tiles   Multi-coloured	1032	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Concrete (poured)	1028,1059,1063,1064,1080,2052	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Concrete (poured)   Painted	1042	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Laminate   Wood Pattern	1042	A	0	0	0	0	Non Asbestos	No	



HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
Asbestos	V0000	Floor     Mastic	1090	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Mastic   (new 2017)	1114	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Rubber   Green	1089	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Floor     Terrazzo	1018,1019,1035,1043,1044,1045,1046,1047,1048 1060,1062,1073,1074,1075,1081,1082,1085,1086 1102,1104,1106,1108,1109,1112,1113,2005,2013 2033,2034,2053	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Terrazzo   Multi-colour	1006,1011,1012,1013,1014,1040,1050,1051,1052 1053,1092,1093,1094,1098,1101,2018,2025,2039 2040,2041,2051	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Terrazzo   Multi-coloured	1029,1030,1031,1032,2048	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Vinyl Floor Tile   12x12 Beige With Brown Flecks	1055	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Floor     Vinyl Floor Tile   12x12 Grey	1010	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Vinyl Floor Tile (no Mastic)   12x12 Beige W Brown Streak (new 2017)	1114	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Vinyl Floor Tile (no Mastic)   12x12 Beige With Blue Flecks (2016)	1067	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Vinyl Floor Tile (no Mastic)   12x12 Grey With White And Dark Grey Fleck (new)	1072	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Vinyl Floor Tile (no Mastic)   New 2017 12x12 Beige Dense Fleck	1090	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Vinyl Floor Tile And Mastic   12x12 Beige	1010	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Floor     Vinyl Sheet Flooring   Vinyl Plank	1033,1034,1036	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor     Wood	1079,1100,2055	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Piping     Fibreglass	1002,1003,1004,1005,1011,1012,1013,1024,1027 1036,1046,1055,1059,1063,1064,1066,1068,1069 1072,1073,1074,1075,1076,1078,1079,1088,1089 1097,1099,1100,1101,1102,1105,1114,2040,2047 2052	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Structure     Concrete (precast)	1069	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Structure   Deck   Steel	1042,1079,1088,1089,1096,1100	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Structure   Deck   Wood	1042	A	0	0	0	0	Non Asbestos	No	

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
Asbestos	V0000	Wall     Ceramic Tiles	1032,1075	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Wall     Ceramic Tiles   Multi-colour	1011,1012,1013	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Wall     Drywall And Joint Compound   (2018)	1076,1116	A,B	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Wall     Masonry	1000,1001,1002,1003,1004,1005,1006,1010,1011,1012,1013,1014,1015,1016,1017,1018,1019,1020,1021,1022,1023,1024,1025,1026,1027,1028,1029,1030,1031,1032,1033,1034,1035,1036,1040,1041,1042,1043,1044,1045,1046,1047,1048,1049,1050,1051,1052,1053,1054,1055,1056,1057,1058,1059,1060,1061,1062,1063,1064,1065,1066,1067,1068,1069,1070,1071,1072,1075,1077,1078,1079,1080,1081,1082,1083,1084,1085,1086,1087,1088,1089,1091,1092,1093,1094,1095,1096,1097,1098,1099,1100,1101,1102,1103,1104,1105,1106,1107,1108,1109,1110,1111,1112,1113,1114,1115,2000,2001,2002,2003,2004,2005,2006,2007,2008,2009,2010,2011,2012,2013,2014,2015,2016,2017,2018,2019,2020,2021,2022,2023,2024,2025,2026,2027,2028,2029,2030,2031,2032,2033,2034,2035,2036,2037,2038,2039,2040,2041,2042,2043,2044,2045,2046,2047,2048,2049,2050,2051,2052,2053,2054	A	0	0	0	0	Non Asbestos	No	

## Legend:

Sample number		Units		
S####	Asbestos sample collected	SF	Square feet	NF Non Friable material.
L####	Paint sample collected	LF	Linear feet	F Friable material
P####	PCB sample collected	EA	Each	PF Potentially Friable material
M####	Mould sample collected	%	Percentage	
V####	Material visually similar to numbered sample collected			
V0000	Known non Hazardous Material			
V9000	Material is visually identified as Hazardous Material			
V9500	Material is presumed to be Hazardous Material			
[Loc. No.]	Abated Material			

**APPENDIX VI**  
**HMIS All Data Report**

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #0 : Presumed Asbestos-Containing Materials  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 0

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Other		N/A, Roofing felts and tar, mastics, Floor levelling compound, Ceramic tile setting compound, Electrical components, Mechanical packing, ropes and gaskets, Vermiculite, Adhesives and duct mastics, Caulking and putties, Fibre-reinforced paints and coatings, Paper products, Soffit and fascia boards, Fire resistant doors, Stucco, plaster or other cementitious parge coatings, Vibration dampers on HVAC equipment, Terrazzo, Ropes and gaskets in cast-iron bell and spigot joints, Sealants on pipe threads			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF

Where present, these materials are assumed to contain asbestos until otherwise proven by sampling and analysis.

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1 : Exterior  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** ALL

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Other		Caulking, black/grey, around louvers	Exterior		A	Y		100(7)			%	S0046ABC	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Other	Expansion Joint	Caulking, white, courtyard	Exterior		A	Y		100(7)			%	S0044ABC	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Other	Window	Caulking	Exterior		A	Y		100(7)			%	S0041ABC	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Other	Window	Caulking, off-white, courtyard	Exterior		A	Y		33			%	S0045ABC	None Detected	N.D.	None	
Other	Window	Caulking, grey, window frame	Exterior		A	Y		100(7)			%	S0049ABC	Chrysotile	0.5-5%	Confirmed Asbestos	NF

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1000 : Classroom 119  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 119  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y		100			%	V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1001 : Classroom 117  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 117  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0042B	None Detected	N.D.	None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1002 : Classroom 115A  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 115A  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white	Exterior		A	Y						S0043ABC	None Detected	N.D.	None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	N		3(7)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Piping		Tar Paper	Insulation		C	N						V0015	None Detected		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1003 : Co-op Office**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #: 115B**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	N		2(7)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1004 : Office**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #: 113A**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0042A	None Detected	N.D.	None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		2(7)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	



**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1005 : Classroom 113**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #: 113**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Red Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1006 : Stairwell  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

**ASBESTOS**

System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1010 : Student Services  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 109  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

**ASBESTOS**

System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 2016			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling	Soffit	Texture Coat	Exterior		C	Y		100			%	S0030A	[None]	0.5-5%	[Abated]	
Floor		Vinyl Floor Tile and Mastic, 12x12 beige			A	Y		100			%	V0000	Non-Asbestos		None	
Floor		Ceramic Tiles			A	Y										
Floor		Mastic, under new non-asbestos floor tiles		Vinyl Floor Tile	D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile, 12x12 grey			A	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1011 : Hallway  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound, 2018			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0018	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Tar Paper	Insulation		C	N						S0015C	None Detected		None	
Piping <sup>1</sup>	Rain Water Leader	Cement Product			B	Y		40(7)			LF	V9500	Presumed Asbestos		Presumed Asbestos	NF
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						S0012F	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Glass			A	Y										

1 - Hatch

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1012 : Hallway  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0018	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small flecks and pinholes (2012)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Tar Paper	Insulation		C	N						V0015	None Detected		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1013 : Hallway  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Wood			C	Y										
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0018	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Tar Paper	Insulation		C	N						V0015	None Detected		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1014 : Stairwell  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1015 : Classroom 113  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 113  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Red Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1016 : Classroom 112  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 112  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1017 : Classroom 114  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 114  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1018 : Girls Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 116  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1019 : Boys Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 118  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	



**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1020 : Classroom 120  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 120  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1021 : Classroom 122  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 122  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1022 : Classroom 124  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 124  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1023 : Classroom 126  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 126  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						S0042D	None Detected	N.D.	None	
Ceiling		Mastic, puck, brown		Ceiling tiles (glue-on)	C	N		100			%	S0047ABC	None Detected	N.D.	None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Blue Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1024 : Classroom 121  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 121  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 SPH			C	Y		900	1		SF	S0036	[None]	0.5-5%	[Abated]	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	N		3			EA	V0033	[None]	25-50%	[Abated]	
Piping		Tar Paper	Insulation		C	N						V0015	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1025 : Classroom 121A  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 121A  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0042C	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Parging Cement	Straight		C	Y		15			LF	S0005B	[None]	25-50%	[Abated]	
Piping		Parging Cement	Fitting		C	Y		2(7)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1026 : Classroom 123  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 123  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 SPH			C	Y		100			%	V0036	[None]	0.5-5%	[Abated]	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1027 : Resource/Spec. Ed  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 125/127  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						S0009C	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Structure					A	Y						V0007	None Detected		None	
Structure		Fireproofing (Cementitious), Beige Spray Applied			C	N						V0008	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1028 : Spec. Education Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 127  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Concrete (poured)		Paint	A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	N						V0008	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1029 : Boys Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Coloured			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1030 : Custodial Closet  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

**ASBESTOS**

System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007C	None Detected		None	
Floor		Terrazzo, Multi-Coloured			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1031 : Girls Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 132  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

**ASBESTOS**

System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Coloured			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1032 : Mens Staff Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small Pinhole			C	Y						V0013	None Detected		None	
Floor		Ceramic Tiles, Multi-Coloured			A	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo, Multi-Coloured			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1033 : Staff Lounge  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Vinyl Floor Tile and Mastic, 12x12 beige with Brown flecks			A	Y		100			%	V9500	[None]		[Abated]	
Floor		Vinyl Sheet Flooring, vinyl plank			A	Y						V0000	Non-Asbestos		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Rose with Brown Fleck			A	Y		100			%	V9500	[None]		[Abated]	
Floor		Vinyl Floor Tile (No Mastic), 9x9 Beige with Brown Fleck			A	Y		100			%	V9500	[None]		[Abated]	
Piping		Not Insulated			C	Y										
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	



**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1034 : Photocopy Supply Room**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #:**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Bulkhead	Drywall and joint compound			C	Y						V0006	None Detected		None	
Floor		Vinyl Sheet Flooring, vinyl plank			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	[None]		[Abated]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1035 : Womens Staff Washroom**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #:**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 White w Multi-Colour Streak			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1036 : Photocopy Room  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Vinyl Sheet Flooring, vinyl plank			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	[None]		[Abated]	
Floor		Vinyl Floor Tile (No Mastic), 9x9 White w Multi-Colour Streak			A	Y		100			%	V9500	[None]		[Abated]	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		2(7)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall <sup>1</sup>		Drywall and joint compound			A	Y		100			%	V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

1 - Adjacent corridor

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1040 : Stairwell  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1041 : Hallway  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 pinhole and texture (2014)			C	Y						V0000	Non-Asbestos		None	
Ceiling	Soffit	Texture Coat			C	Y		100(7)			%	S0050ABC	Chrysotile	0.5-5%	Confirmed Asbestos	F
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1042 : Library  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Textured Pinhole			C	Y						V0019	None Detected		None	
Floor		Concrete (poured), Painted			A	Y						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, 12x12 green flecks			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Carpet			A	Y						V0000	Non-Asbestos		None	
Floor		Laminate, Wood Pattern			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass		Polyvinyl chloride (PVC)	A	Y										
Structure	Deck	Steel			C	Y						V0000	Non-Asbestos		None	
Structure	Deck	Wood			C	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch    **Site:** Secondary  
**Location:** #1043 : Hallway    **Floor:** 1  
**Survey Date:** 2018-08-03

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						S0011C	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch    **Site:** Secondary  
**Location:** #1044 : Hallway    **Floor:** 1  
**Survey Date:** 2018-08-03

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						S0012E	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1045 : Cafeteria  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 pinhole flecks			C	Y						V0035	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1046 : Kitchen  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass			C	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		4(7)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1047 : Math Department  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

**ASBESTOS**

System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		700			SF	V0034	None Detected	N.D.	None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1048 : Stairwell  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

**ASBESTOS**

System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1049 : Classroom 131  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 131  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007D	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Brown Streak			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass		Polyvinyl chloride (PVC)	A	Y										
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1050 : Hallway  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small Pinhole			C	Y						V0013	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	



**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1051 : Hallway  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small Pinhole			C	Y						V0013	None Detected		None	
Floor		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass			C	N										
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1052 : Hallway  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small Pinhole			C	Y						V0013	None Detected		None	
Floor		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1053 : Woodworking Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0006	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Other	Electric Light Fixture	Foil Face			C	Y		1(7)			EA	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1054 : Custodial Closet  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Beige w Brown Streak			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1055 : Chapel  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling		Texture Coat			C	Y		1200(7)			SF	V0031	Chrysotile	0.5-5%	Confirmed Asbestos	F
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Stickdown Scattered			C	Y						S0024A	None Detected		None	
Floor		Carpet			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile, 12x12 beige with Brown flecks			A	Y		100			%	V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						S0006C	None Detected		None	
Wall		Plaster			A	Y						V0007	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1056 : Chapel Office**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #:**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Stickdown Scattered			C	Y						V0024	None Detected		None	
Floor		Carpet			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1057 : Classroom T-152**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #: T-152**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Beige w Brown Streak			A	Y		97(7)	3(7)		%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Plaster			A	Y						V0007	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1058 : Classroom T-154  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** T-154  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Laminate, Wood			A	Y										
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Beige w Brown Streak			A	Y		100			%	V9500	[None]		[Abated]	
Wall		Drywall and joint compound			A	Y		100			%	V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1059 : Boiler Room  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** T-156  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0006	None Detected		None	
Floor		Concrete (poured)			A	Y						V0000	Non-Asbestos		None	
Other	Fire Door	Thermal Insulation			D	N		1(7)			EA	V9500	Presumed Asbestos		Presumed Asbestos	F
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1060 : Boiler Room Lockers  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1061 : Boiler Room Tool Room  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y		100			%	V0007	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement			A	Y		2(5)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Piping		Parging Cement			C	Y		2(7)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1062 : Boiler Room Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1063 : Woodworking  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** T-160  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Concrete (precast)			C	Y						V0000	Non-Asbestos		None	
Ceiling		Ceiling Tiles (lay-in), Horizontal			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Concrete (poured)			A	Y						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, 12x12 beige with Brown streaks			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Ceramic Tiles			A	Y										
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		30(7)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Piping		Parging Cement	Fitting		A	Y		10(5)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	



**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1064 : Transportation Services  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Concrete (poured)			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		55(7)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Piping		Parging Cement	Fitting		A	Y		7(5)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Piping		Aircell			A	Y		20(5)			LF	S0039	Chrysotile	5-10%	Confirmed Asbestos	F
Piping		Aircell			C	Y		200(7)			LF	S0039	Chrysotile	5-10%	Confirmed Asbestos	F
Structure		Concrete (precast)			C	Y										
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1065 : Art T-149B  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** T-149B  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Concrete (precast)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N						S0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y		100			%	S0037	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1066 : Art T-149A  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** T-149A  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Concrete (precast)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Other	Sink	Mastic, Gold			A	Y		1(7)			EA	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1067 : Tech Services T-157B  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** T-157B  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2016			C	Y						V0000	Non-Asbestos		None	
Ceiling		Drywall and joint compound			C	Y		100			%	V0006	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 beige with blue flecks (2016)			A	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1068 : Tech Services T-157A  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** T-157A  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Concrete (precast)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		9(7)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1069 : Manufacturing**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #: T-155**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		35(7)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Piping		Parging Cement	Fitting		A	Y		4(5)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Structure		Concrete (precast)			C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1070 : Studio**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #: T-153S**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Concrete (precast)			C	Y						V0000	Non-Asbestos		None	
Ceiling		Ceiling Tiles (lay-in), 24" x 48" random width-wise fissures			C	Y		100			%	S0040	None Detected	N.D.	None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1071 : Computer Lab  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** T-153G  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						S0006D	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Other	Countertop	Wood			A	Y										
Other	Sink	Mastic, Gold			A	Y		1(7)			EA	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1072 : Computer Engineering  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** T-151  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Concrete (precast)			C	N						V0000	Non-Asbestos		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Blue Dense Fleck (under counters)			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Orange with Brown Streak (under counters)			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 grey with white and dark grey fleck (new)			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y		100			%	V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch    **Site:** Secondary  
**Location:** #1073 : Hallway    **Floor:** 1  
**Survey Date:** 2018-08-03

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						S0010A	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small Pinhole			C	Y						S0013A	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Tar Paper	Insulation		C	N						S0015A	None Detected		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray Applied			C	N						S0012A	None Detected		None	

**Client:** Hamilton-Wentworth Catholic District Sch    **Site:** Secondary  
**Location:** #1074 : Hallway    **Floor:** 1  
**Survey Date:** 2018-08-03

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						S0011A	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						S0010B	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small Pinhole			C	Y						V0013	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1075 : Vestibule  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound, (2018)			C	Y						V0000	Non-Asbestos		None	
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling		Abated Material, 2x2 Large Fissure			C	Y						V0020	[None]		[Abated]	
Ceiling		Abated Material, 2x2 Small Pinhole			C	Y						V0021	[None]		[Abated]	
Ceiling		Abated Material, 2x2 Textured Pinhole			C	Y						V0019	[None]		[Abated]	
Ceiling		Abated Material, 2x2 Horizontal Fissure			C	Y						S0017A	[None]		[Abated]	
Ceiling		Abated Material, 2x4 Scattered Pattern			C	Y						V0010	[None]		[Abated]	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Scattered Pattern			C	Y						V0018	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						S0012C	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1076 : Front Foyer  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound, (2018)			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling		Abated Material, 2x2 Large Fissure			C	Y						S0020A	[None]		[Abated]	
Ceiling		Abated Material, 2x2 Small Pinhole			C	Y						S0021A	[None]		[Abated]	
Ceiling		Abated Material, 2x2 Textured Pinhole			C	Y						S0019A	[None]		[Abated]	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Scattered Pattern			C	Y						S0018A	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spay-Applied			C	N						V0012	None Detected		None	
Wall		Drywall and joint compound, (2018)			A	Y		100			%	V0000	Non-Asbestos		None	



**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1077 : Stairs  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Vinyl Floor Tile and Mastic, 12x12 beige and browns flecks			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor <sup>1</sup>		Vinyl Floor Tile (No Mastic), 9x9 Brown w White Streak			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Not Insulated			A	Y										
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

1 - On stairs

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1078 : Auditorium  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 ph flecks (2016)			C	Y						V0000	Non-Asbestos		None	
Floor		Concrete (poured)			A	Y										
Floor		Carpet			A	Y										
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Tectum			C	Y										

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1079 : Stage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Wood			A	Y						V0000	Non-Asbestos		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)								V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	Y						V0008	None Detected		None	
Structure	Deck	Steel			C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1080 : Auditorium Hallway**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #:**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Concrete (poured)			A	Y						V0000	Non-Asbestos		None	
Other	Electric Light Fixture	Foil Face			C	Y		2(7)			EA	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Not Insulated			A	Y										
Wall		Plaster			A	Y						S0022A	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1081 : Stage Hallway**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #:**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Other	Light Fixture	Foil Face, On Incandescent Lights			C	Y		100			%	V0015	None Detected		None	
Piping <sup>1</sup>		Parging Cement	Fitting		A	Y		6(5)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Stucco			A	Y						V0022	None Detected		None	

1 - On stair landing

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1082 : Auditorium Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0006	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Other	Light Fixture	Foil Face			C	N		100(7)			%	V0016	Chrysotile	25-50%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1083 : Kilters Room  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1084 : Co-Inst. Office  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2x4 2018			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling		Drywall and joint compound			C	N						V0006	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry		Ceramic Tiles	A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1085 : Boys Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1086 : Girls Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1087 : Mens Locker Room  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		2x4 Horizontal Fissure			C	Y						S0011B	None Detected		None	
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						S0010C	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Structure		Fireproofing (Cementitious), Beige Spray Applied			C	N						S0008D	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1088 : Phys Ed. Department  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Structure	Deck	Steel			C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1089 : Fitness Centre  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Rubber, Green			A	Y		100			%	V0000	Non-Asbestos		None	
Floor		Mastic		Rubber	D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Structure	Deck	Steel			C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1090 : Music Room  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Carpet			A	Y										
Floor		Mastic			D	N						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile (No Mastic), New 2017 12x12 beige Dense Fleck			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass			C	Y										
Wall		Plaster			A	Y						V0007	None Detected		None	
Wall		Masonry			A	Y										



**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1091 : Gym Storage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Piping		Fibreglass			A	Y										
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1092 : Gym Storage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007B	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1093 : Gym Storage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

**ASBESTOS**

System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007B	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1094 : Gym Storage Corridor  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

**ASBESTOS**

System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			C	Y						S0006B	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1095 : Gym Storage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007B	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1096 : Gym Storage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Structure	Deck	Steel			C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1097 : Gym Storage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation		A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1098 : Gym Storage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1099 : Gym Storage**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #:**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1100 : Gym**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #:**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						S0009A	None Detected		None	
Duct <sup>1</sup>		Fibreglass w/Parging			C	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	F
Floor		Wood			A	Y						V0000	Non-Asbestos		None	
Floor <sup>2</sup>		Vinyl Floor Tile and Mastic			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Structure	Deck	Steel			C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

1 - Suspect at elevated height  
2 - Corridor

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1101 : Hallway to Gym  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1102 : Hallway Foyer  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Scattered Pattern			C	Y						V0018	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						S0012A	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1103 : Staff Locker Room  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1104 : Hallway to Gym  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	N						S0008A	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1105 : Womens Locker Room  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y		100			%	V0006	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	N						V0008	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	



**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1106 : Custodial Closet  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1107 : Womens Locker Room  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						S0009B	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass			C	N										
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	N						V0008	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1108 : Custodial Closet  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:** 116B  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007D	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass			C	Y										
Piping		Horsehair			C	Y										
Piping		Tar Paper	Insulation		C	Y						V0015	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1109 : Custodial Closet  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1110 : Storage**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #:**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Vinyl Floor Tile and Mastic, 9x9 beige			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Other	Light Fixture	Foil Face, On Incandescent Lights			C	N		2(7)			EA	V0016	Chrysotile	25-50%	Confirmed Asbestos	NF
Piping		Not Insulated			C	Y										
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1111 : Boiler Room Lunchroom**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #:**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1112 : Gym Storage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Vinyl Floor Tile and Mastic, 12x12 green flecks			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	N						V0008	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1113 : Hallway to Gym  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	N						S0008A	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1114 : Storage**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #:**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic, (new 2017)			D	N						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Brown Streak (new 2017)			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #1115 : Storage by Stage**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 1**

**Building Name: St Jean de Brebeuf**  
**Room #:**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Wood			A	Y										
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Other	Light Fixture	Foil Face, On Incandescent Lights			C	N		2(7)			EA	V0016	Chrysotile	25-50%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #1116 : 2018 Addition  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 1

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Duct		Not Insulated			C	Y										
Floor		Ceramic Tiles			A	Y										
Piping		Fibreglass		Polyvinyl chloride (PVC)	C	Y										
Piping		Not Insulated			C	Y										
Structure		Steel			C	Y										
Wall		Drywall and joint compound, (2018)			A	Y		100			%	V0000	Non-Asbestos		None	
Wall		Masonry			A	Y										

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2000 : French Classroom 219  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 219  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2001 : French Classroom 217  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 217  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						S0042F	None Detected	N.D.	None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2002 : English Office 215  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 215  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Laminate, Wood			A	Y										
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]	0.5-5%	[Abated]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #2003 : Storage**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 2**

**Building Name: St Jean de Brebeuf**  
**Room #:**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		200(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		200			SF	V0038	[None]		[None]	
Other	Countertop	Bakelite			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #2004 : Science Classroom 213**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 2**

**Building Name: St Jean de Brebeuf**  
**Room #: 213**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop				A	Y		100()			%	V9500	Presumed Asbestos		Presumed Asbestos	
Other	Door	Cement Product			A	Y		50(7)			SF	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y						S0006F	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	



**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2005 : Stairwell  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2006 : English Classroom 211  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 211  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2007 : Science Classroom 209  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 209  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Lime Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop	Bakelite			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2008 : Storage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 208  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Duct		Not Insulated			C	Y										
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2009 : Science Classroom 207  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 207  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop	Bakelite			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other <sup>1</sup>	Fumehood	Cement Product			A	Y		70(7)			SF	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

1 - Includes cabinet below

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2010 : Science Classroom 205  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 205  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop	Bakelite			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Sink	Bakelite			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, grey, window sill	Exterior		C	Y						S0048ABC	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2011 : Science Classroom 203  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 203  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop	Bakelite			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Sink	Bakelite			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2012 : Classroom 201  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 201  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						S0042E	None Detected	N.D.	None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		750			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2013 : Stairwell  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2014 : Classroom 240  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 240  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						S0007E	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Other	Sink	Mastic, Gold			A	Y		1(7)			EA	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2015 : Classroom 237  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 237  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in)			C	Y						V0009	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass			A	Y										
Wall		Plaster			A	Y						V0007	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2016 : Classroom 235  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 235  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in)			C	Y						V0009	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Lime Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2017 : Classroom 233  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 233  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in)			C	Y						V0009	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	



**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2018 : Stairwell  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2019 : History Classroom 231  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 231  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2020 : Math Classroom 229  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 229  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2021 : Math Classroom 227  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 227  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2022 : Math Classroom 225  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 225  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Floor		Mastic			D	N		800(7)			SF	S0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	S0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2023 : Family Studies 223  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 223  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2024 : Family Studies 221  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 221  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2025 : Stairwell  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2026 : Hallway  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Mastic			A	Y		100(7)			%	S0051C	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Abated Material, 12x12 Beige w Tan Streak													[Abated]	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2027 : Hallway  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Mastic			A	Y		1000(7)			SF	S0051B	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Abated Material, 12x12 Beige w Tan Streak													[Abated]	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2028 : Hallway  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Mastic			A	Y		1000(7)			SF	V0051	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Abated Material, 12x12 Beige w Tan Streak													[Abated]	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2029 : Hallway  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Mastic			A	Y		1000(7)			SF	S0051A	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Abated Material, 12x12 Beige w Tan Streak													[Abated]	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2030 : English Classroom 210  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 210  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Brown Streak			A	Y		800(7)			SF	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2031 : English Classroom 212  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 212  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic, 12x12 Beige w Tan Streak			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2032 : English Classroom 214  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 214  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2033 : Girls Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	



**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2034 : Boys Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2035 : French Classroom 220  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 220  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch    **Site:** Secondary  
**Location:** #2036 : French Classroom 222            **Floor:** 2  
**Survey Date:** 2018-08-03

**Building Name:** St Jean de Brebeuf  
**Room #:** 222  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch    **Site:** Secondary  
**Location:** #2037 : Math Classroom 224            **Floor:** 2  
**Survey Date:** 2018-08-03

**Building Name:** St Jean de Brebeuf  
**Room #:** 224  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2038 : Math Classroom 226  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 226  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800(7)			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]		[None]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2039 : Boys Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2040 : Custodial Closet  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007G	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass			B	N						V0000	Non-Asbestos		None	
Piping		Tar Paper	Insulation		B	N						V0015	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2041 : Girls Washroom  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2042 : Storage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2043 : Science Classroom 234  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 234  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0042G	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 beige Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop															
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2044 : History Classroom 236  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 236  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Lime Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2045 : Storage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Beige w Brown Streak			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Light Fixture	Foil Face, On Incandescent Lights			C	N		1(7)			EA	S0016A	Chrysotile	25-50%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2046 : Foyer  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement			C	Y		2(7)			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2047 : Storage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Beige w Brown Streak			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2048 : Stairwell  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Coloured			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2049 : Dance Studio 200A  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:** 200A  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Vinyl Sheet Flooring, Faux Wood Pattern			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	PF
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	



**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #2050 : Health Sciences 200B**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 2**

**Building Name: St Jean de Brebeuf**  
**Room #: 200B**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Rubber			A	Y										
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			D	N						V0037	None Detected		None	
Wall		Drywall and joint compound			A	Y						S0006A	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client: Hamilton-Wentworth Catholic District Sch**  
**Location: #2051 : Stairwell**  
**Survey Date: 2018-08-03**

**Site: Secondary**  
**Floor: 2**

**Building Name: St Jean de Brebeuf**  
**Room #:**  
**Last Re-Assessment: 2023-08-01**

**Area (sqft): 0**

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0006	None Detected		None	
Ceiling		Plaster			C	Y						S0007A	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Straight		C	Y		15(7)			LF	S0005A	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2052 : Fan Room  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Deck	Steel			C	Y						V0000	Non-Asbestos		None	
Duct		Parging Cement, Parging on seam			C	Y						S0002A	None Detected		None	
Duct		Canvas	Insulation	Fibreglass	C	Y						V0000	Non-Asbestos		None	
Floor		Concrete (poured)			B	Y						V0000	Non-Asbestos		None	
Other	Electrical Panel	Cement Product			A	Y		100			%	S0003A	[None]	0.5-5%	[Abated]	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Piping		Armaflex			B	Y										
Piping	Heating Water Supply	Parging Cement			B	Y				1	EA					
Structure	Beam, Deck	Fireproofing (Cementitious), Grey Spray-Applied			C	Y						S0001A	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Fibreglass, Fibreglass Backing			A	Y						S0004A	None Detected		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2053 : Custodial Closet  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007G	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2054 : Science Storage  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop	Bakelite			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other <sup>1</sup>	Door	Cement Product			A	Y		160(7)			SF	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

1 - Both acid cabinets

**Client:** Hamilton-Wentworth Catholic District Sch  
**Location:** #2055 : Catwalk  
**Survey Date:** 2018-08-03

**Site:** Secondary  
**Floor:** 2

**Building Name:** St Jean de Brebeuf  
**Room #:**  
**Last Re-Assessment:** 2023-08-01

**Area (sqft):** 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Wood			A	Y						V0000	Non-Asbestos		None	
Piping		Tar Paper, abated 2016	Insulation		C	Y		100			%	S0032A	[None]	0.5-5%	[Abated]	
Wall		Drywall and joint compound			A	Y						S0006E	None Detected		None	
Wall		Texture Coat, abated 2016		Plaster	A	Y		100			%	S0031A	[None]	0.5-5%	[Abated]	

## Legend:



Sample number		Units		Other	
S####	Asbestos sample collected	SF	Square feet	A	Access
V####	Material visually similar to numbered sample collected	LF	Linear feet	V	Visible
V0000	Known non-asbestos material	EA	Each	AP	Air Plenum
V9000	Visually identified as an asbestos material	%	Percentage	F	Friable material
V9500	Material is presumed to be an asbestos material			NF	Non Friable material
				PF	Potentially Friable material

Access	
A	Accessible to all building occupants
B	Accessible to maintenance and operations staff without a ladder
C	Accessible to maintenance and operations staff with a ladder. Also rarely entered, locked areas
D	Not normally accessible

Condition	
Good	No visible damage or deterioration
Fair	Minor, repairable damage, cracking, delamination or deterioration
Poor	Irreparable damage or deterioration with exposed and missing material

Visible	
Y	The material is visible when standing on the floor of the room, without the removal or opening of other building components (e.g. ceiling tiles or access panels).
N	The material is not visible to view when standing on the floor of the room and requires the removal of a building component (e.g. ceilings tiles or access panels) to view and access. Includes rarely entered crawlspaces, attic spaces, etc. Observations will be limited to the extent visible from the access points.

Air Plenum	
Yes or No	The material is in a return air plenum or in a direct airstream or there is evidence of air erosion (e.g. duct for heating or cooling blowing directly on or across an ACM). This field is only completed where Air Plenum consideration is required by regulation.

Colour Coding	
	The material is known to contain regulated concentrations of asbestos; either by analytical results or visible identification (use of the V9000 code).
	The material is presumed to contain asbestos; based on visual appearances; typically a material known to historically contain asbestos; however, not sampled due to limited access or the destructive nature of the sampling.

Action					
(1)	Clean up of ACM Debris	(2)	Precautions for Access Which may Disturb ACM Debris	(3)	ACM removal
(4)	Precautions for Work Which may Disturb ACM in Poor Condition	(5)	Proactive ACM removal (Minimum repair required for fair condition)	(6)	ACM repair
(7)	Management program and surveillance				